

GeoMax Zoom20/30/35 Pro Series

User Manual



Version 2.0

Introduction

Purchase

Congratulations on the purchase of a GeoMax Zoom instrument.



This manual contains important safety directions as well as instructions for setting up the product and operating it. Refer to "1 Safety Directions" for further information. Read carefully through the User Manual before you switch on the product.

Product identification

The type and serial number of your product are indicated on the type plate. Enter the type and serial number in your manual and always refer to this information when you need to contact your agency or GeoMax authorised service workshop.


Type: _____

Serial No.: _____


Trademarks

- Windows is a registered trademark of Microsoft Corporation in the United States and other countries
 - *Bluetooth*[®] is a registered trademark of Bluetooth SIG, Inc.
 - SD Logo is a trademark of SD-3C, LLC.
- All other trademarks are the property of their respective owners.

Validity of this manual

	Description
General	<p>This manual applies to Zoom20 Pro, Zoom30 Pro and Zoom35 Pro instruments. Where there are differences between the instruments they are clearly described.</p> <p> The appearance of the products are subject to change without notice. The appearance of the actual product may vary slightly from the product shown in the illustrations.</p>
Telescope	<ul style="list-style-type: none">• Measuring with IR modes: When measuring distances to a reflector with Electronic Distance Measurement (EDM) mode "IR", the telescope uses a wide visible red laser beam, which emerges coaxially from the telescope's objective.• Measuring with RL modes: Instruments that are equipped with a reflectorless EDM additionally offer the EDM mode "Reflectorless (RL)". When measuring distances with this EDM mode, the telescope uses a narrow visible red laser beam, which emerges coaxially from the telescope's objective.

WARNING

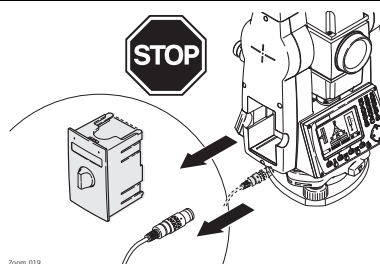

Do **NOT** remove the battery during operation of the instrument, or during the shutdown procedure.

This can result in a file system error and data loss!

Always switch off the instrument by pressing the On/Off key, and wait until the instrument has shutdown completely before removing the battery.

Table of Contents

In this manual	Chapter	Page
1	Safety Directions	6
1.1	General	6
1.2	Definition of Use	6
1.3	Limits of Use	7
1.4	Responsibilities	7
1.5	Hazards of Use	7
1.6	Laser Classification	8
1.6.1	General	8
1.6.2	Distancer, Measurements with Reflectors	9
1.6.3	Distancer, Measurements without Reflectors (Reflectorless mode)	9
1.6.4	Navigation Light	11
1.6.5	Laser Plummet	11
1.7	Electromagnetic Compatibility EMC	12
1.8	FCC Statement, Applicable in U.S.	13
2	Description of the System	15
2.1	System Components	15
2.2	Container Contents	15
2.3	Instrument Components	16
3	User Interface	17
3.1	Keyboard	17
3.2	Screen	17
3.3	Status Icons	18
3.4	Softkeys	18
3.5	Operating Principles	19
3.6	Pointsearch	19
4	Operation	21
4.1	Instrument Setup	21
4.2	Working with the Battery	22
4.3	Data Storage	23
4.4	Main Menu	23
4.5	Survey Application	24
4.6	Distance Measurements - Guidelines for Correct Results	24
5	Settings	26
5.1	General Settings	26
5.2	EDM Settings	28
5.3	Communication Settings	29
6	Tools	31
6.1	Calibration	31
6.2	Auto Start Routine	31
6.3	System Information	31
6.4	Loading Software	32
7	Functions	33
7.1	Overview	33
7.2	Distance Offset	33
7.3	Z-Coordinate	34
7.4	2 Dist. Offset	34
7.5	Brg/Dist	35
7.6	EDM Continuous	36
8	Coding	37
9	Applications - Getting Started	38
9.1	Overview	38
9.2	Starting an Application	38
9.3	Selecting the Job	38
9.4	Selecting the Station	39
9.5	Selecting the Orientation	39
9.5.1	Overview	39

	9.5.2	Manual Orientation	40
	9.5.3	Orientation with Coordinates	40
10	Applications		42
10.1	Common Fields		42
10.2	Survey		42
10.3	Reference Element - Reference Line		42
	10.3.1	Overview	42
	10.3.2	Defining the Base Line	43
	10.3.3	Defining the Reference Line	43
	10.3.4	Subapplication Measure Line & Offset	44
	10.3.5	Subapplication Setout	44
10.4	Reference Element - Reference Arc		46
	10.4.1	Overview	46
	10.4.2	Defining the Reference Arc	46
	10.4.3	Subapplication Measure Line & Offset	46
	10.4.4	Subapplication Setout	47
10.5	COGO		48
	10.5.1	Starting COGO	48
	10.5.2	Inverse and Traverse	49
	10.5.3	Intersections	49
	10.5.4	Offsets	50
	10.5.5	Extension	51
10.6	Missing Line Measurement		51
10.7	Resection		52
	10.7.1	Starting Resection	52
	10.7.2	Measuring Information	53
	10.7.3	Computation Procedure	53
	10.7.4	Resection Results	53
10.8	Set Out		54
10.9	Area & Volume		55
10.10	Remote Elevation		57
10.11	Construction		57
	10.11.1	Starting Construction	57
	10.11.2	Layout	58
	10.11.3	As Built Check	58
10.12	Road		59
11	Data Management		61
11.1	Data Management		61
11.2	Exporting Data		61
11.3	Importing Data		62
11.4	Working with a USB Memory Stick		63
11.5	Working with Bluetooth		63
11.6	Working with GeoMax Geo Office and GGO Tools		64
12	Calibration		65
12.1	Overview		65
12.2	Preparation		65
12.3	Calibrating Line-of-Sight and Vertical Index Error		65
12.4	Calibrating the Circular Level of the Instrument and Tribrach		67
12.5	Inspecting the Laser Plummet of the Instrument		67
12.6	Servicing the Tripod		68
13	Care and Transport		69
13.1	Transport		69
13.2	Storage		69
13.3	Cleaning and Drying		69
14	Technical Data		70
14.1	Angle Measurement		70
14.2	Distance Measurement with Reflectors		70
14.3	Distancer, Measurements without Reflectors (Reflectorless mode)		71
14.4	Distance Measurement Reflector (Long Range)		72
14.5	Conformity to National Regulations		72
	14.5.1	Zoom20 Pro	72
	14.5.2	Zoom30 Pro/Zoom35 Pro	72
14.6	General Technical Data of the Instrument		72

14.7	Scale Correction	74
14.8	Reduction Formulas	75
15	Software Licence Agreement	77
16	Glossary	78
Appendix A	Menu Tree	80
Appendix B	Directory Structure	81
Index		82

1 Safety Directions

1.1 General

Description

The following directions enable the person responsible for the product, and the person who actually uses the equipment, to anticipate and avoid operational hazards.

The person responsible for the product must ensure that all users understand these directions and adhere to them.

About Warning Messages





Warning messages are an essential part of the safety concept of the instrument. They appear wherever hazards or hazardous situations can occur.

Warning messages...

- make the user alert about direct and indirect hazards concerning the use of the product.
- contain general rules of behaviour.

For the users' safety, all safety instructions and safety messages shall be strictly observed and followed! Therefore, the manual must always be available to all persons performing any tasks described herein.

DANGER, WARNING, CAUTION and **NOTICE** are standardized signal words for identifying levels of hazards and risks related to personal injury and property damage. For your safety it is important to read and fully understand the table below with the different signal words and their definitions! Supplementary safety information symbols may be placed within a warning message as well as supplementary text.

Type	Description
 DANGER	Indicates an imminently hazardous situation which, if not avoided, will result in death or serious injury.
 WARNING	Indicates a potentially hazardous situation or an unintended use which, if not avoided, could result in death or serious injury.
 CAUTION	Indicates a potentially hazardous situation or an unintended use which, if not avoided, may result in minor or moderate injury.
NOTICE	Indicates a potentially hazardous situation or an unintended use which, if not avoided, may result in appreciable material, financial and environmental damage.
	Important paragraphs which must be adhered to in practice as they enable the product to be used in a technically correct and efficient manner.

1.2 Definition of Use

Intended use


- Measuring horizontal and vertical angles.
- Measuring distances.
- Recording measurements.
- Visualizing the aiming direction and vertical axis.
- Data communication with external appliances.
- Computing by means of software.

Reasonably foreseeable misuse

- Use of the product without instruction.
- Use outside of the intended use and limits.
- Disabling safety systems.
- Removal of hazard notices.
- Opening the product using tools, for example screwdriver, unless this is specifically permitted for certain functions.
- Modification or conversion of the product.
- Use after misappropriation.
- Use of products with obviously recognisable damages or defects.
- Use with accessories from other manufacturers without the prior explicit approval of GeoMax.
- Aiming directly into the sun.
- Inadequate safeguards at the working site.
- Deliberate dazzling of third parties.
- Controlling of machines, moving objects or similar monitoring application without additional control- and safety installations.

1.3 Limits of Use

Environment Suitable for use in an atmosphere appropriate for permanent human habitation: not suitable for use in aggressive or explosive environments.

 **DANGER** Local safety authorities and safety experts must be contacted before working in hazardous areas, or close to electrical installations or similar situations by the person in charge of the product.


1.4 Responsibilities

Manufacturer of the product GeoMax AG, CH-9443 Widnau, hereinafter referred to as GeoMax, is responsible for supplying the product, including the user manual and original accessories, in a safe condition.


Person responsible for the product The person responsible for the product has the following duties:

- To understand the safety instructions on the product and the instructions in the user manual.
- To ensure that it is used in accordance with the instructions.
- To be familiar with local regulations relating to safety and accident prevention.
- To inform GeoMax immediately if the product and the application becomes unsafe.
- To ensure that the national laws, regulations and conditions for the operation of e.g. radio transmitters, lasers are respected.

1.5 Hazards of Use


 **CAUTION** Watch out for erroneous measurement results if the product has been dropped or has been misused, modified, stored for long periods or transported.

Precautions: Periodically carry out test measurements and perform the field adjustments indicated in the user manual, particularly after the product has been subjected to abnormal use and before and after important measurements.


 **DANGER** Because of the risk of electrocution, it is dangerous to use poles and extensions in the vicinity of electrical installations such as power cables or electrical railways.

Precautions: Keep at a safe distance from electrical installations. If it is essential to work in this environment, first contact the safety authorities responsible for the electrical installations and follow their instructions.




 **CAUTION** Be careful when pointing the product towards the sun, because the telescope functions as a magnifying glass and can injure your eyes and/or cause damage inside the product.


Precautions: Do not point the product directly at the sun.

 **WARNING** During dynamic applications, for example stakeout procedures there is a danger of accidents occurring if the user does not pay attention to the environmental conditions around, for example obstacles, excavations or traffic.








Precautions: The person responsible for the product must make all users fully aware of the existing dangers.


 **WARNING** Inadequate securing of the working site can lead to dangerous situations, for example in traffic, on building sites, and at industrial installations.

Precautions: Always ensure that the working site is adequately secured. Adhere to the regulations governing safety and accident prevention and road traffic.

 **CAUTION** If the accessories used with the product are not properly secured and the product is subjected to mechanical shock, for example blows or falling, the product may be damaged or people can sustain injury.

Precautions: When setting-up the product, make sure that the accessories are correctly adapted, fitted, secured, and locked in position. Avoid subjecting the product to mechanical stress.

-  **WARNING** If the product is used with accessories, for example masts, staffs, poles, you may increase the risk of being struck by lightning.
Precautions:
Do not use the product in a thunderstorm.
-
-  **CAUTION** During the transport, shipping or disposal of batteries it is possible for inappropriate mechanical influences to constitute a fire hazard.
Precautions:
Before shipping the product or disposing of it, discharge the batteries by running the product until they are flat.
When transporting or shipping batteries, the person in charge of the product must ensure that the applicable national and international rules and regulations are observed. Before transportation or shipping contact your local passenger or freight transport company.
-
-  **WARNING** High mechanical stress, high ambient temperatures or immersion into fluids can cause leakage, fire or explosions of the batteries.
Precautions:
Protect the batteries from mechanical influences and high ambient temperatures. Do not drop or immerse batteries into fluids.
-
-  **WARNING** If battery terminals are short circuited e.g. by coming in contact with jewellery, keys, metalized paper or other metals, the battery can overheat and cause injury or fire, for example by storing or transporting in pockets.
Precautions:
Make sure that the battery terminals do not come into contact with metallic objects.
-
-  **WARNING** If you open the product, either of the following actions may cause you to receive an electric shock.
- Touching live components
 - Using the product after incorrect attempts were made to carry out repairs
- Precautions:**
Do not open the product. Only Leica Geosystems authorised service workshops are entitled to repair these products.
-
-  **WARNING** If the product is improperly disposed of, the following can happen:
- If polymer parts are burnt, poisonous gases are produced which may impair health.
 - If batteries are damaged or are heated strongly, they can explode and cause poisoning, burning, corrosion or environmental contamination.
 - By disposing of the product irresponsibly you may enable unauthorised persons to use it in contravention of the regulations, exposing themselves and third parties to the risk of severe injury and rendering the environment liable to contamination.
- Precautions:**
- 

The product must not be disposed with household waste. Dispose of the product appropriately in accordance with the national regulations in force in your country. Always prevent access to the product by unauthorised personnel.
- Product-specific treatment and waste management information is available from GeoMax AG.
-
-  **WARNING** Only GeoMax authorised service workshops are entitled to repair these products.

1.6

Laser Classification

1.6.1

General

General

The following chapters provide instructions and training information about laser safety according to international standard IEC 60825-1 (2007-03) and technical report IEC TR 60825-14 (2004-02). The information enables the person responsible for the product and the person who actually uses the equipment, to anticipate and avoid operational hazards.



According to IEC TR 60825-14 (2004-02), products classified as laser class 1, class 2 and class 3R do not require:

- laser safety officer involvement,
- protective clothes and eyewear,
- special warning signs in the laser working area



if used and operated as defined in this User Manual due to the low eye hazard level. National laws and local regulations could impose more stringent instructions for the safe use of lasers than IEC 60825-1 (2007-03) and IEC TR 60825-14 (2004-02).

1.6.2

Distancer, Measurements with Reflectors

General

The EDM module built into the product produces a visible laser beam which emerges from the telescope objective.


The laser product described in this section is classified as laser class 1 in accordance with:

- IEC 60825-1 (2007-03): "Safety of laser products"
- EN 60825-1 (2007-10): "Safety of laser products"

These products are safe under reasonably foreseeable conditions of operation and are not harmful to the eyes provided that the products are used and maintained in accordance with this User Manual.

Description	Value (A2/A4/A6)	Value (A10)
Maximum average radiant power	0.33 mW	0.33 mW
Pulse duration	400 ps	800 ps
Pulse repetition frequency	320 MHz	100 MHz - 150 MHz
Wavelength	650 nm - 690 nm	650 nm - 690 nm

Labelling

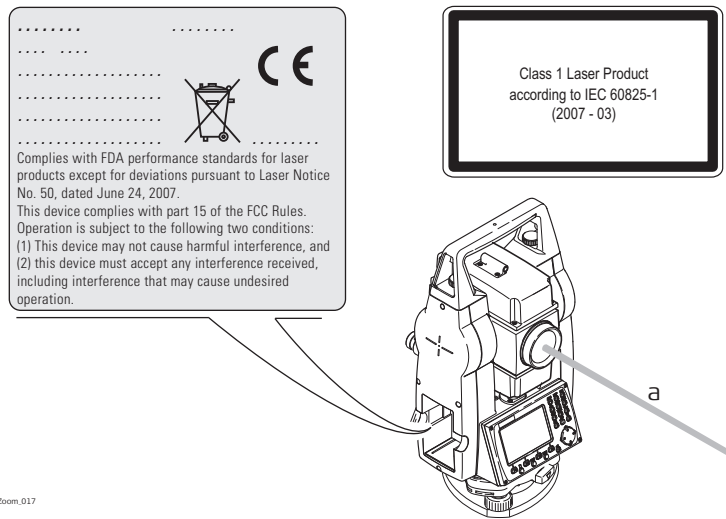

Zoom_017

a) Laser beam

1.6.3

Distancer, Measurements without Reflectors (Reflectorless mode)

General

The EDM module built into the product produces a visible laser beam which emerges from the telescope objective.

The laser product described in this section is classified as laser class 3R in accordance with:

- IEC 60825-1 (2007-03): "Safety of laser products"
- EN 60825-1 (2007-10): "Safety of laser products"

Direct intrabeam viewing may be hazardous (low eye hazard level), in particular for deliberate ocular exposure. The beam may cause dazzle, flash-blindness and after-images, particularly under low ambient light conditions. The risk of injury for laser class 3R products is limited because of:

- unintentional exposure would rarely reflect worst case conditions of (e.g.) beam alignment with the pupil, worst case accommodation,
- inherent safety margin in the maximum permissible exposure to laser radiation (MPE)
- natural aversion behaviour for exposure to bright light for the case of visible radiation.

Description	Value (A2/A4/A6)	Value (A10)
Maximum average radiant power	4.75 mW	5.00 mW
Pulse duration	400 ps	800 ps
Pulse repetition frequency	320 MHz	100 MHz - 150 MHz
Wavelength	650 nm - 690 nm	650 nm - 690 nm
Beam divergence	0.2 mrad x 0.3 mrad	0.2 mrad x 0.3 mrad

Description	Value (A2/A4/A6)	Value (A10)
NOHD (Nominal Ocular Hazard Distance) @ 0.25 s	67 m / 220 ft	80 m / 262 ft

CAUTION

From a safety perspective, class 3R laser products should be treated as potentially hazardous.

Precautions:

- 1) Prevent direct eye exposure to the beam.
- 2) Do not direct the beam at other people or animals or into areas where people uninvolved in the laser work may be present.


CAUTION

Potential hazards are not only related to direct beams but also to reflected beams aimed at reflecting surfaces such as prisms, windows, mirrors, metallic surfaces, etc.

Precautions:

- 1) Do not aim at areas that are essentially reflective, such as a mirror, or which could emit unwanted reflections apart from the target areas.
- 2) Do not look through or beside the optical sight at prisms or reflecting objects when the laser is switched on, in laser pointer or distance measurement mode. Aiming at prisms is only permitted when looking through the telescope.


Labelling

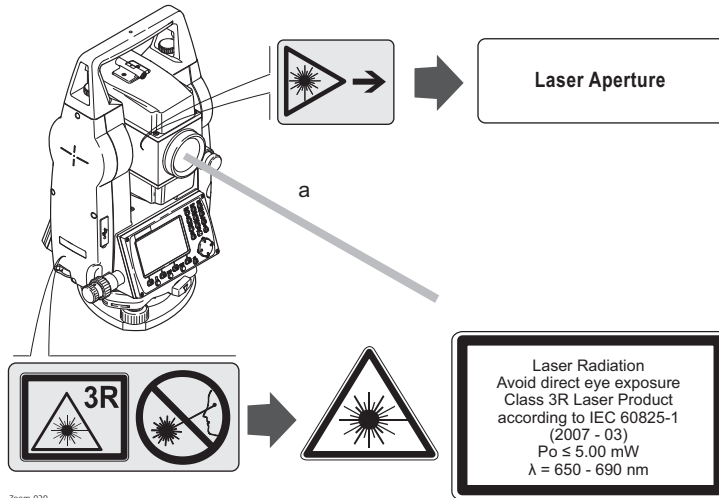

Zoom_020
a) Laser beam

Complies with FDA performance standards for laser products except for deviations pursuant to Laser Notice No. 50, dated June 24, 2007.

This device complies with part 15 of the FCC Rules. Operation is subject to the following two conditions:
(1) This device may not cause harmful interference, and
(2) this device must accept any interference received, including interference that may cause undesired operation.

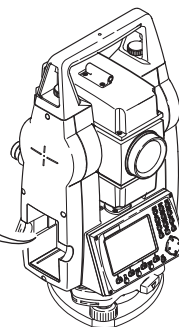

Zoom_018

1.6.4

Navigation Light

General


The integrated Navigation Light produces a visible LED beam from the front side of the telescope.



The product described in this section, is excluded from the scope of IEC 60825-1 (2007-03): "Safety of laser products".

The product described in this section, is classified as exempt group in accordance with IEC 62471 (2006-07) and does not pose any hazard provided that the product is used and maintained in accordance with this user manual.

Class 1 LED Product
according to IEC 60825-1
(2001 - 08)

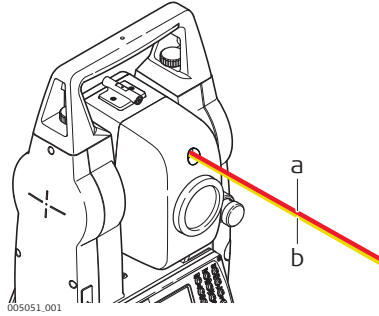

- a) LED beam red
- b) LED beam yellow

1.6.5

Laser Plummet

General

The laser plummet built into the product produces a visible red laser beam which emerges from the bottom of the product.

The laser product described in this section is classified as laser class 2 in accordance with:

- IEC 60825-1 (2007-03): "Safety of laser products"
- EN 60825-1 (2007-10): "Safety of laser products"

These products are safe for momentary exposures but can be hazardous for deliberate staring into the beam. The beam may cause dazzle, flash-blindness and after-images, particularly under low ambient light conditions.

Description	Value
Wavelength	650 nm - 690 nm
Maximum average radiant power	0.95 mW
Pulse duration	c.w.
Pulse repetition frequency (PRF)	c.w.
Beam divergence	<1.5 mrad




CAUTION

From a safety perspective, class 2 laser products are not inherently safe for the eyes.


Precautions:

- 1) Avoid staring into the beam.
- 2) Avoid pointing the beam at other people or animals.

Labelling

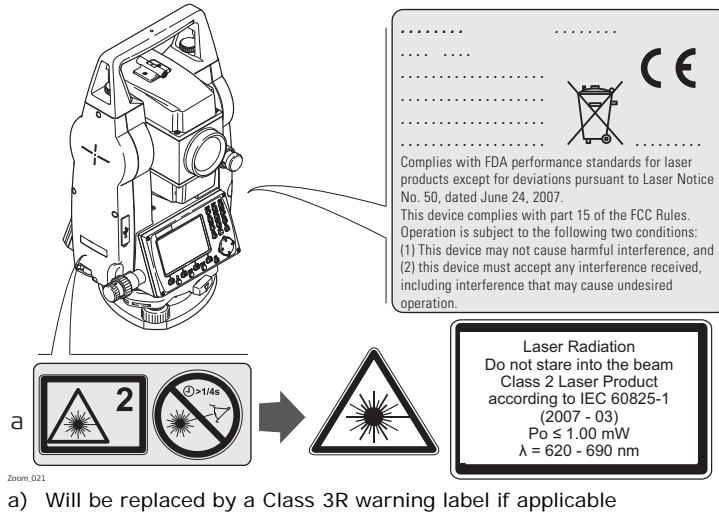

a) Will be replaced by a Class 3R warning label if applicable

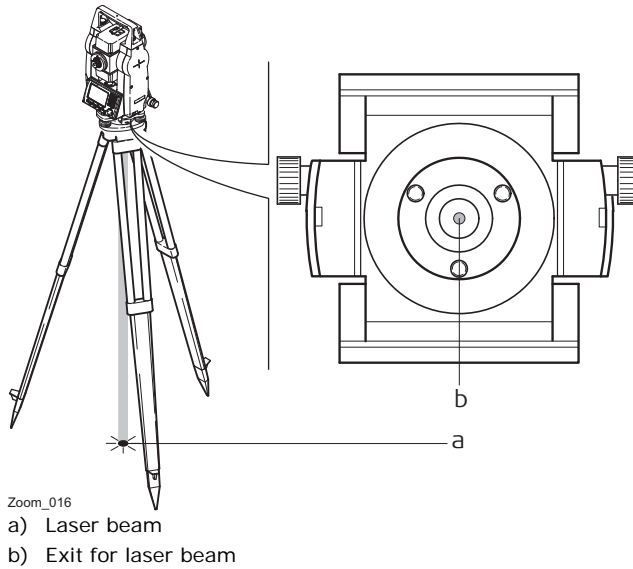

a) Laser beam
b) Exit for laser beam

1.7 Electromagnetic Compatibility EMC

Description

The term Electromagnetic Compatibility is taken to mean the capability of the product to function smoothly in an environment where electromagnetic radiation and electrostatic discharges are present, and without causing electromagnetic disturbances to other equipment.

WARNING

Electromagnetic radiation can cause disturbances in other equipment.

Although the product meets the strict regulations and standards which are in force in this respect, GeoMax cannot completely exclude the possibility that other equipment may be disturbed.

CAUTION

There is a risk that disturbances may be caused in other equipment if the product is used with accessories from other manufacturers, for example field computers, personal computers or other electronic equipment, non-standard cables or external batteries.

Precautions:

Use only the equipment and accessories recommended by GeoMax. When combined with the product, they meet the strict requirements stipulated by the guidelines and standards. When using computers or other electronic equipment, pay attention to the information about electromagnetic compatibility provided by the manufacturer.

CAUTION

Disturbances caused by electromagnetic radiation can result in erroneous measurements. Although the product meets the strict regulations and standards which are in force in this respect, GeoMax cannot completely exclude the possibility that the product may be disturbed by intense electromagnetic radiation, for example, near radio transmitters, two-way radios or diesel generators.

Precautions:

Check the plausibility of results obtained under these conditions.

CAUTION

If the product is operated with connecting cables attached at only one of their two ends, for example external supply cables, interface cables, the permitted level of electromagnetic radiation may be exceeded and the correct functioning of other products may be impaired.

Precautions:

While the product is in use, connecting cables, for example product to external battery, product to computer, must be connected at both ends.

Bluetooth

Use of product with Bluetooth:

WARNING

Electromagnetic radiation can cause disturbances in other equipment, in installations, in medical devices, for example pacemakers or hearing aids and in aircraft. It can also affect humans and animals.

Precautions:

Although the product meets in combination with radio or digital cellular phone devices recommended by GeoMax the strict regulations and standards which are in force in this respect, GeoMax cannot completely exclude the possibility that other equipment may be disturbed or that humans or animals may be affected.

- Do not operate the product with radio or digital cellular phone devices in the vicinity of filling stations or chemical installations, or in other areas where an explosion hazard exists.
- Do not operate the product with radio or digital cellular phone devices near to medical equipment.
- Do not operate the product with radio or digital cellular phone devices in aircraft.

1.8

FCC Statement, Applicable in U.S.

Applicability

The greyed paragraph below is only applicable for Zoom20 Pro instruments.

WARNING

This equipment has been tested and found to comply with the limits for a Class B digital device, pursuant to part 15 of the FCC rules.

These limits are designed to provide reasonable protection against harmful interference in a residential installation.

This equipment generates, uses and can radiate radio frequency energy and, if not installed and used in accordance with the instructions, may cause harmful interference to radio communications. However, there is no guarantee that interference will not occur in a particular installation.



If this equipment does cause harmful interference to radio or television reception, which can be determined by turning the equipment off and on, the user is encouraged to try to correct the interference by one or more of the following measures:

- Reorient or relocate the receiving antenna.
- Increase the separation between the equipment and the receiver.
- Connect the equipment into an outlet on a circuit different from that to which the receiver is connected.
- Consult the dealer or an experienced radio/TV technician for help.

WARNING


Changes or modifications not expressly approved by GeoMax for compliance could void the user's authority to operate the equipment.

Labelling Zoom instrument

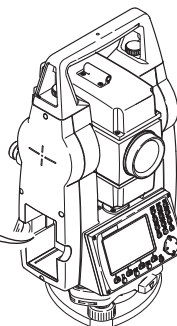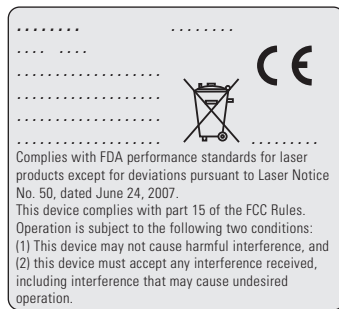

Zoom_018

**Labelling internal
battery ZBA400**

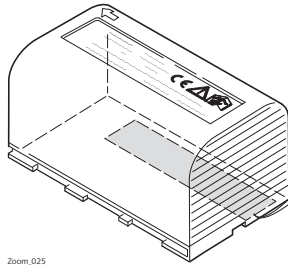

Zoom_025


This device complies with part 15 of the FCC Rules. Operation is subject to the following two conditions: (1) This device may not cause harmful interference, and (2) this device must accept any interference received, including interference that may cause undesired operation.

UL US LISTED
ITE Accessory
E179078 . 70YL

2 Description of the System

2.1 System Components

Main Components

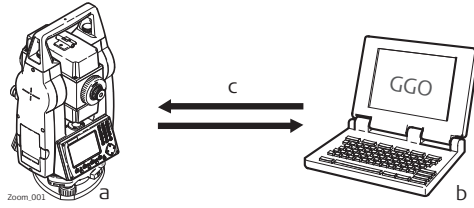


- a) Instrument
- b) Computer with GGO or GGO Tools software
- c) Data transfer

Component	Description
Instrument	An instrument for measuring, calculating and capturing data. Ideally suited for tasks from simple surveys to complex applications. The various lines have a range of accuracy classes and support different features. All lines can be connected with GGO or GGO Tools to view, exchange and manage data.
Firmware	The firmware package installed on the instrument. Consists of a standard base operating system with optional additional features.
GGO or GGO Tools software	An office software consisting of a suite of standard and extended programs for the viewing, exchanging, managing and post processing of data.
Data transfer	Data can be always transferred between an instrument and a computer via a data transfer cable, USB memory stick or USB cable. For Zoom30 Pro/Zoom35 Pro instruments data can also be transferred via Bluetooth.


2.2 Container Contents

Container contents part 1 of 2

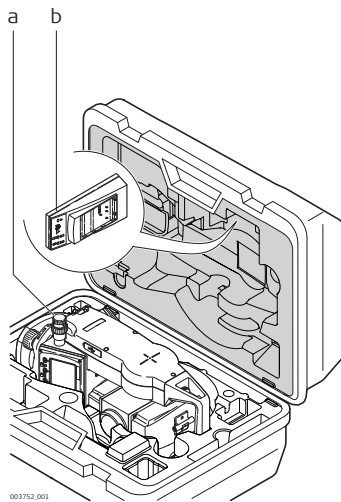

- a) Instrument with tribrach
 - b) ZCH201 battery charger*
- * Optional

**Container contents part
2 of 2**

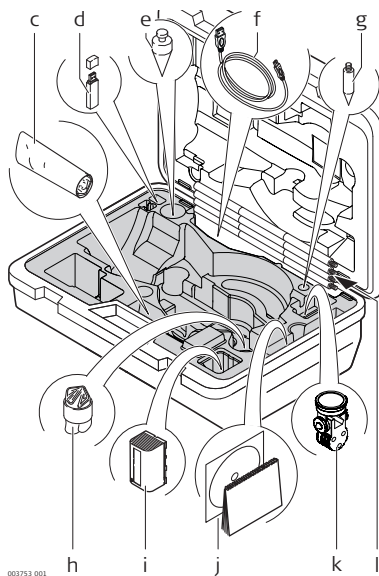


- c) Adjustment tools
- d) USB memory stick
- e) Plumb bob
- f) ZDC220 USB cable
- g) Tip for mini prism pole*
- h) Protective cover
- i) ZBA400 battery*
- j) Manuals
- k) ZPM100 mini prism*
- l) Mini prism pole*

* Optional

2.3 Instrument Components


**Instrument components
part 1 of 2**

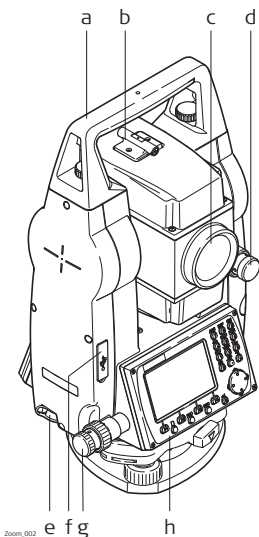

- a) Detachable carrying handle
- b) Optical sight
- c) Objective with integrated Electronic Distance Measurement (EDM). Exit for EDM laser beam
- d) Vertical drive
- e) Interface RS232/USB
- f) USB host port
- g) Horizontal drive
- h) Second keyboard*

* Optional

**Instrument components
part 2 of 2**

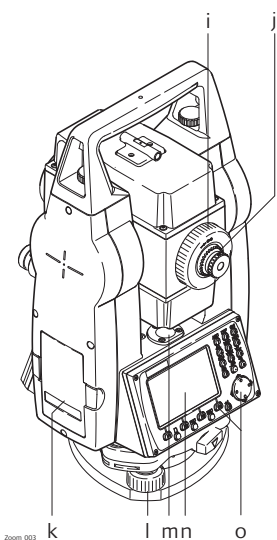


- i) Focusing telescope image
- j) Eyepiece; focusing graticule
- k) Battery cover
- l) Foot screw
- m) Circular level
- n) Display
- o) Keyboard

3 User Interface

3.1 Keyboard

Keyboard

The keyboard layout may differ depending on the instrument model.

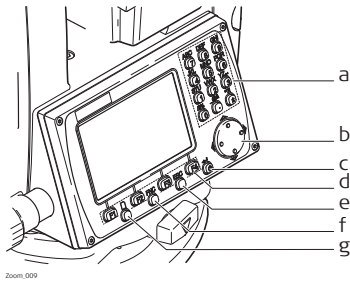

- a) Alphanumeric keypad
- b) Navigation key
- c) **ENTER** key
- d) Function keys **F1** to **F4**
- e) **ESC** key
- f) **FNC** key
- g) **PAGE** key

Keys

Key	Description
	Page key. Displays the next screen when several screens are available.
	FNC key. Quick-access to measurement supporting functions.
	Navigation key. Controls the focus bar within the screen and the entry bar within a field.
	ENTER key. Confirms an entry and continues to the next field.
	ESC key. Quits a screen or edit mode without saving changes. Returns to next higher level.
	Function keys that are assigned the variable functions displayed at the bottom of the screen.
	Alphanumeric keypad for entry of text and numerical values.


3.2 Screen

Screen

The instruments are available with Black&White or with Color&Touch display.


All shown screens are examples. It is possible that local firmware versions are different to the basic version.

Black&White screen:

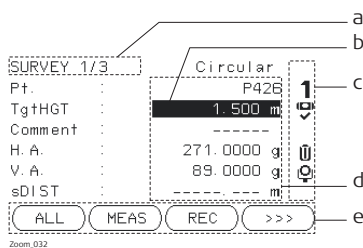

- a) Title of screen
- b) Focus in screen. Active field
- c) Status icons
- d) Fields
- e) Softkeys

Color&Touch screen:

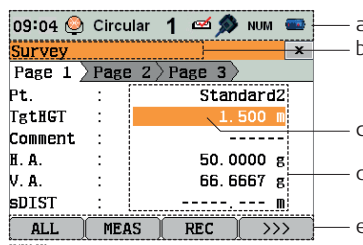

- a) Status icons
- b) Title of screen
- c) Focus in screen. Active field
- d) Fields
- e) Softkeys

Tap on an icon or field to run a function.



















3.3

Status Icons

Description

The icons provide status information related to basic instrument functions. Depending on the display type, different icons are displayed.

Icons

Icon		Description
B&W	C&T	
		The battery symbol indicates the level of the remaining battery capacity, 75% full shown in the example. For C&T: Tapping the icon opens the SYSTEM INFO screen.
		Compensator is on. For C&T: Tapping the icon opens the LEVEL & PLUMMET screen.
		Compensator is off. For C&T: Tapping the icon opens the SETTINGS screen.
		IR EDM mode for measuring to prisms and reflective targets. For C&T: Tapping the icon opens the EDM SETTINGS screen.
		RL EDM mode for measuring to all targets. For C&T: Tapping the icon opens the EDM SETTINGS screen.
NUM	NUM	Keypad is set to numeric mode.
a	a	Keypad is set to alphanumeric mode.
1	1	Indicates telescope position is face I. For C&T: Tapping the icon opens the LEVEL & PLUMMET screen.
2	2	Indicates telescope position is face II. For C&T: Tapping the icon opens the LEVEL & PLUMMET screen.
		Bluetooth is connected. If there is a cross beside the icon, the Bluetooth communication port is selected, but the status is inactive. For C&T: Tapping the icon opens the COMMUNICATION SETTINGS screen.
		USB communication port is selected. For C&T: Tapping the icon opens the COMMUNICATION SETTINGS screen.
		RS232 communication port is selected. For C&T: Tapping the icon opens the COMMUNICATION SETTINGS screen.
		A double arrow indicates a field has a selectable list.

3.4

Softkeys

Description

Softkeys are selected using the relevant **F1** to **F4** function key. This chapter describes the functionality of the common softkeys used by the system. The more specialised softkeys are described where they appear in the application chapters.

Common softkey functions

Key	Description
ALPHA	To change the keypad operation to alphanumeric.
NUM	To change the keypad operation to numerical.
ALL	To start distance and angle measurements and save the measured values.
BACK	To return to the last active screen.
COORD	To open the manual coordinate entry screen.
EDM	To view and change EDM settings. Refer to "5.2 EDM Settings".
EXIT	To exit the screen or application.
MEAS	To start distance and angle measurements without saving the measured values.
OK	If entry screen: Confirms measured or entered values and continues the process. If message screen: Confirms message and continues with selected action or returns to the previous screen to reselect an option.
IR/RL	To toggle between IR and RL EDM modes.
DISPL.	To display the list of available points.
REC	To save the displayed values.
DEFLT	To reset all editable fields to their default values.

Key	Description
SEARCH	To search for an entered point.
VIEW	To display the coordinate and job details of the selected point.
>>>	To display the next softkey level.


3.5 Operating Principles

Turn instrument on/off Use the On/Off key.


Alphanumeric keypad The alphanumeric keypad is used to enter characters directly into editable fields.

- **Numeric fields:** Can only contain numerical values. By pressing a key of the keypad the number will be displayed.
- **Alphanumeric fields:** Can contain numbers and letters. By pressing a key of the keypad the first character written above that key will be displayed. By pressing several times you can toggle through the characters. For example: 1->S->T->U->1->S....


Edit fields




ESC Deletes any change and restores the previous value.




Moves the cursor to the left




Moves the cursor to the right.




Inserts a character at the cursor position.




Deletes the character at the cursor position.

 In edit mode the position of the decimal place cannot be changed. The decimal place is skipped.

Special characters

Character	Description
*	Used as wildcards in search fields for point numbers or codes. Refer to "3.6 Pointsearch".
+/-	In the alphanumeric character set "+" and "-" are treated as normal alphanumeric characters with no mathematical function.  "+" / "-" only appear in front of an entry.

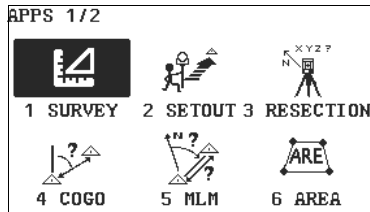


In this example selecting 2 on an alphanumeric keyboard would start the Set Out application.

3.6 Pointsearch

Description Pointsearch is a function used by applications to find measured or fixed points in the memory storage. It is possible to limit the point search to a particular job or to search the whole storage. The search procedure always finds fixed points before measured points that fulfill the same search criteria. If several points meet the search criteria, then the results are ordered according to the entry date. The instrument finds the most recent fixed point first.

Direct search By entering an actual point number, for example 402, and pressing **SEARCH**, all points within the selected job and with the corresponding point number are found.

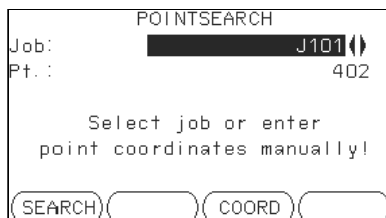

SEARCH
To search for matching points within the selected job.

Wildcard search

The wildcard search is indicated by a "*". The asterisk is a place holder for any following sequence of characters. Wildcards should be used if the point number is not fully known, or to search for a batch of points.

Examples of point searches

- * All points are found.
 - A All points with exactly the point number "A" are found.
 - A* All points starting with "A" are found, for example, A9, A15, ABCD, A2A.
 - *1 All points containing only one "1" are found, for example, 1, A1, AB1.
 - A*1 All points starting with "A" and containing only one "1" are found, for example, A1, AB1, A51.
-

4

Operation

4.1

Instrument Setup

Description


This topic describes an instrument setup over a marked ground point using the laser plummet. It is always possible to set up the instrument without the need for a marked ground point.




Important features

- It is always recommended to shield the instrument from direct sunlight and avoid uneven temperatures around the instrument.
- The laser plummet described in this topic is built into the vertical axis of the instrument. It projects a red spot onto the ground, making it appreciably easier to centre the instrument.
- The laser plummet cannot be used with a tribrach equipped with an optical plummet.

Tripod

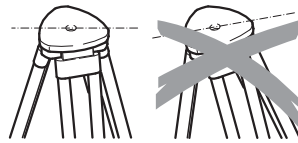


When setting up the tripod pay attention to ensuring a horizontal position of the tripod plate. Slight corrections of inclination can be made with the foot screws of the tribrach. Larger corrections must be done with the tripod legs.

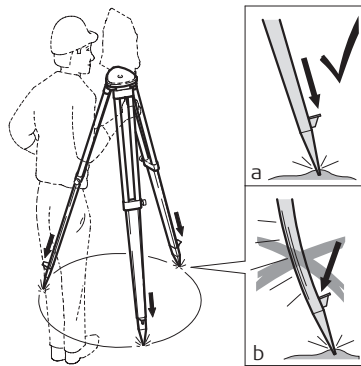

Loosen the clamping screws on the tripod legs, pull out to the required length and tighten the clamps.


- a) In order to guarantee a firm foothold sufficiently press the tripod legs into the ground.
- b) When pressing the legs into the ground note that the force must be applied along the legs.

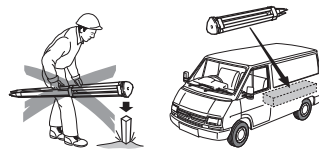

Careful handling of tripod.

- Check all screws and bolts for correct fit.
- During transport always use the cover supplied.
- Use the tripod only for surveying tasks.

Setup step-by-step

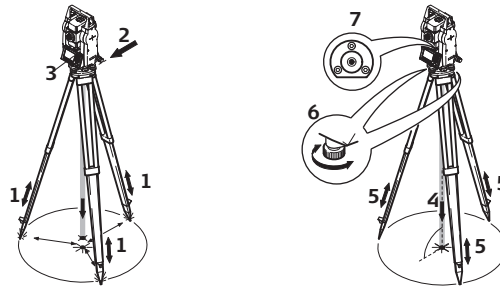


- 1 Extend the tripod legs to allow for a comfortable working posture. Position the tripod over the marked ground point, centring it as best as possible.
- 2 Fasten the tribrach and instrument onto the tripod.
- 3 Turn on the instrument, and, if tilt correction is set to 1- or 2-axis, the laser plummet will be activated automatically, and the **Level Up** screen appears. Otherwise, press **FNC** from within any application and select **Level**.
- 4 Move the tripod legs (1) and use the tribrach footscrews (6) to center the plummet (4) over the ground point.
- 5 Adjust the tripod legs (5) to level the circular level (7).
- 6 By using the electronic level, turn the tribrach footscrews (6) to precisely level the instrument. Refer to "Level up with the electronic level step-by-step".
- 7 Center the instrument precisely over the ground point by shifting the tribrach on the tripod plate (2).
- 8 Repeat steps 6 and 7 until the required accuracy is achieved.


Level up with the electronic level step-by-step

The electronic level can be used to precisely level up the instrument using the footscrews of the tribrach.


- 1) Turn the instrument until it is parallel to two footscrews.
- 2) Center the circular level approximately by turning the footscrews of the tribrach.
- 3) Turn on the instrument, and, if tilt correction is set to 1- or 2-axis, the laser plummet will be activated automatically, and the **Level Up** screen appears. Otherwise, press **FNC** from within any application and select **Level**.


 The bubble of the electronic level appears if the instrument tilt is inside a certain levelling range.


- 4) Center the electronic level of the first axis by turning the two footscrews. When the electronic level is centered, the indicator on one of the electronic bubbles is centered.

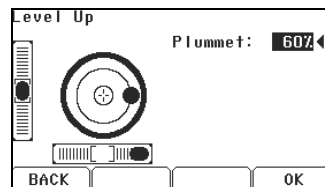

- 5) Center the electronic level for the second axis by turning the last footscrew. When the electronic level is centered, the indicator on the second electronic bubble is centered.

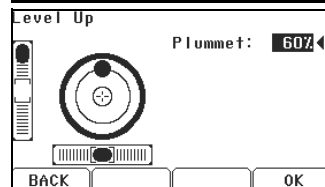


 When the electronic level is centered the instrument has been perfectly levelled up.

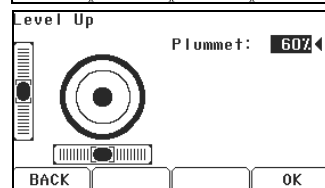

- 6) Accept with **OK**.


Change the intensity of the laser plummet

External influences and the surface conditions may require the adjustment of the intensity of the laser plummet.

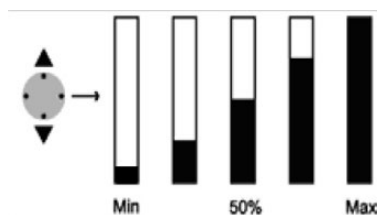

In the **Level Up** screen, adjust the intensity of the laser plummet using the navigation key. The laser can be adjusted in 25% steps as required.

Position over pipes or holes

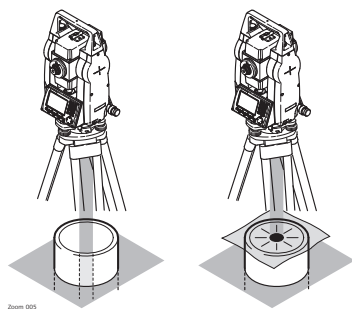

Under some circumstances the laser dot is not visible, for example over pipes. In this case, using a transparent plate enables the laser dot to be seen and then easily aligned to the center of the pipe.

4.2

Working with the Battery

Charging / first-time use


- The battery must be charged prior to using it for the first time because it is delivered with an energy content as low as possible.
- The permissible temperature range for charging is between 0°C to +40°C/+32°F to +104°F. For optimal charging we recommend charging the batteries at a low ambient temperature of +10°C to +20°C/+50°F to +68°F if possible.
- It is normal for the battery to become warm during charging. Using the chargers recommended by GeoMax, it is not possible to charge the battery if the temperature is too high.

- For new batteries or batteries that have been stored for a long time (> three months), it is effectual to make only one charge/discharge cycle.
- For Li-Ion batteries, a single discharging and charging cycle is sufficient. We recommend carrying out the process when the battery capacity indicated on the charger or on a GeoMax product deviates significantly from the actual battery capacity available.

Operation / Discharging


- The batteries can be operated from -20°C to +55°C/-4°F to +131°F.
- Low operating temperatures reduce the capacity that can be drawn; high operating temperatures reduce the service life of the battery.

Change the battery step-by-step

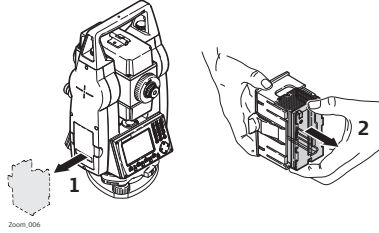

Open the battery compartment (1) and remove the battery holder.

Remove the battery from the battery holder (2).

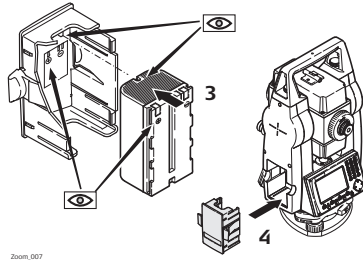

Insert the new battery into the battery holder (3), ensuring that the contacts are facing outward. The battery should click into position.

Insert the battery holder back into the battery compartment (4).



The polarity of the battery is displayed inside the battery housing.

4.3 Data Storage

Description


An internal memory is included in all instruments. The firmware stores all data in jobs in a database in the internal memory. Data can then be transferred to a computer. For Zoom30 Pro/Zoom35 Pro instruments, data can also be transferred from the internal memory to a computer or other device via a Bluetooth connection. Refer to "11 Data Management" for further information on data management and data transfer.

4.4 Main Menu

Description

The **MAIN MENU** is the starting place for accessing all functionality of the instrument. It is usually displayed immediately after the **Level & Plummet** screen, after switching on the instrument.

MAIN MENU

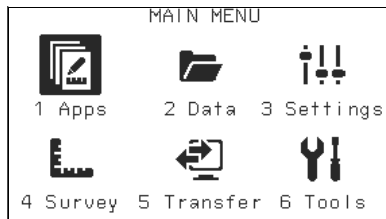

Description of the MAIN MENU functions

Function	Description
Apps	To select and start applications. Refer to "10 Applications".
Data	To manage jobs, data, codelists, formats, system memory and USB memory stick files. Refer to "11 Data Management".
Settings	To change EDM configurations, communication and general instrument settings. Refer to "5 Settings".
Survey	Survey program to begin measuring immediately. Refer to "4.5 Survey Application".
Transfer	To export and import data. Refer to "11.2 Exporting Data".

Function	Description
Tools	To access instrument related tools such as calibrations, personal start up settings, licence keys and system information. Refer to "6 Tools".



If desired, the instrument can be configured to start in a user defined place after the **Level & Plummet** screen, instead of the **MAIN MENU**. Refer to "6.2 Auto Start Routine".

4.5 Survey Application

Description After switching on and setting up correctly, the instrument is immediately ready for measuring.

Access Select **Survey** from the **MAIN MENU**.

SURVEY

SURVEY 1/3		Circular	
Pt.	:	P401	1
TgtHGT	:	1.500 m	↓
Comment	:	-----	
H. A.	:	25.7000 g	⊞
V. A.	:	83.2300 g	⊞
sDIST	:	26.000 m	
<div style="display: flex; justify-content: space-around;"> ALL MEAS REC >>> </div>			

>>> CODING

To find/enter codes. Refer to "8 Coding".

>>> STN

To enter station data and set the station.

>>> Set HA

To set the horizontal direction orientation.


The procedure for the quick start **Survey** is identical to the procedure for the application **Survey** available under the **Apps** menu. Therefore this procedure is only described once within the application chapter. Refer to "10.2 Survey".

4.6 Distance Measurements - Guidelines for Correct Results

Description A laser distancer (EDM) is incorporated into the instruments. In all versions, the distance can be determined by using a visible red laser beam which emerges coaxially from the telescope objective. There are two EDM modes:

- Prism measurements (IR)
- Reflectorless measurements (RL)

RL measurements

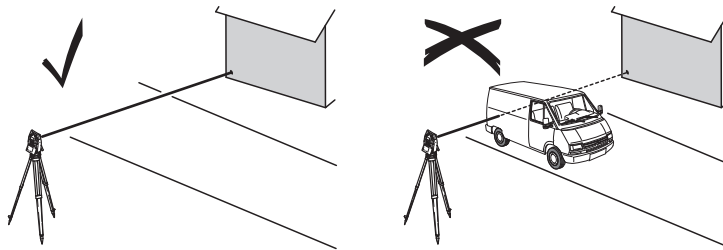

- When a distance measurement is triggered, the EDM measures to the object which is in the beam path at that moment. If a temporary obstruction, for example a passing vehicle, heavy rain, fog or snow is between the instrument and the point to be measured, the EDM may measure to the obstruction.
- Be sure that the laser beam is not reflected by anything close to the line of sight, for example highly reflective objects.
- Avoid interrupting the measuring beam while taking reflectorless measurements or measurements using reflective foils.
- Do not measure with two instruments to the same target simultaneously.

IR measurements

- Accurate measurements to prisms should be made in IR-Default mode.
- Measurements to strongly reflecting targets such as traffic lights in Prism mode without a prism should be avoided. The measured distances may be wrong or inaccurate.
- When a distance measurement is triggered, the EDM measures to the object which is in the beam path at that moment. If for example people, cars, animals, or swaying branches cross the laser beam while a measurement is being taken, a fraction of the laser beam is reflected from these objects and may lead to incorrect distance values.
- Measurements to prisms are only critical if an object crosses the measuring beam at a distance of 0 to 30 m and the distance to be measured is more than 300 m.
- In practice, because the measuring time is very short, the user can always find a way of avoiding unwanted objects from interfering in the beam path.



WARNING

Due to laser safety regulations and measuring accuracy, using the Long Range Reflectorless EDM is only allowed to prisms that are more than 1000 m (3300 ft) away.


5

Settings


5.1

General Settings

Access


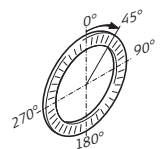
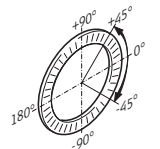
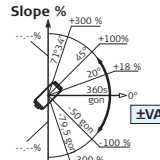

- 1) Select **Settings** from the **MAIN MENU**.
- 2) Select **General** from the **SETTINGS** menu.
- 3) Press  to scroll through the screens of available settings.


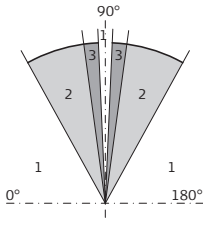

SETTINGS

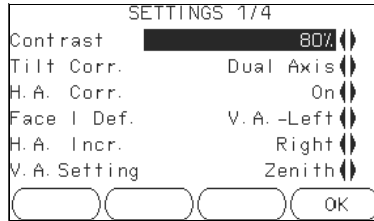



DeLng

To delete a selected language.

Field	Description
Contrast	0% to 100% Sets the display contrast in 10% steps.
Tilt Corr.	<p>Off Tilting compensation deactivated.</p> <p>Single Axis Vertical angles refer to the plummet line.</p> <p>Dual Axis Vertical angles refer to the plummet line and the horizontal directions are corrected by the standing axis tilt. For corrections depending on the HA Corr: setting, refer to the table "Tilt and horizontal corrections".</p> <p> If the instrument is used on an unstable base, for example a shaking platform or ship, the compensator should be deactivated. This avoids the compensator drifting out of it's measuring range and interrupting the measuring process by indicating an error.</p>
HA Corr.	<p>On Horizontal corrections are activated. For normal operation the horizontal correction should remain active. Each measured horizontal angle will be corrected, depending on the vertical angle. For corrections depending on the Tilt Corr: setting, refer to the table "Tilt and horizontal corrections".</p> <p>Off Horizontal corrections are deactivated.</p>
Face I Def.	<p>Sets the face I in relation to the position of the vertical drive.</p> <p>VA-Left Sets face I to be when the vertical drive is on the left of the instrument.</p> <p>VA-Right Sets face I to be when the vertical drive is on the right of the instrument.</p>
HA Incr.	<p>Right Set horizontal angle to clockwise direction measurement.</p> <p>Left Set horizontal angle to counter-clockwise direction measurement. Counter-clockwise directions are displayed but are saved as clockwise directions.</p>
VA-Setting	<p>Sets the vertical angle.</p> <p>Zenith  Zenith=0°; Horizon=90°.</p> <p>Horizont  Zenith=90°; Horizon=0°. Vertical angles are positive above the horizon and negative below it.</p> <p>Slope %  45° = 100%; Horizon=0°. Vertical angles are expressed in % with positive above the horizon and negative below it.  The % value increases rapidly. --.--% appears on the display above 300%.</p>

Field	Description
Angle Unit 	Sets the units shown for all angular fields. <ul style="list-style-type: none"> ° ' " Degree sexagesimal. Possible angle values: 0° to 359°59'59" dec. deg Degree decimal. Possible angle values: 0° to 359.999° gon Gon. Possible angle values: 0 gon to 399.999 gon mil Mil. Possible angle values: 0 to 6399.99mil. The setting of the angle units can be changed at any time. The actual displayed values are converted according to the selected unit.
Min. Reading	Sets the number of decimal places shown for all angular fields. This is for data display and does not apply to data export or storage. For Angle Unit ° ' " : (0° 00' 01" / 0° 00' 05" / 0° 00' 10"). Dec.deg : (0.0001 / 0.0005 / 0.001). Gon : (0.0001 / 0.0005 / 0.001). Mil : (0.01 / 0.05 / 0.1).
Dist. Unit	Sets the units shown for all distance and coordinate related fields. <ul style="list-style-type: none"> meter Meters [m]. ft (US) US feet [ft]. ft (INT) International feet [fi]. ft-in/16 US feet-inch-1/16 inch [ft].
Temp. Unit	Sets the units shown for all temperature fields. <ul style="list-style-type: none"> °C Degree Celsius. °F Degree Fahrenheit.
Press.Unit	Sets the units shown for all pressure fields. <ul style="list-style-type: none"> hPa Hecto Pascal. mbar Millibar. mmHg Millimeter mercury. inHg Inch mercury.
Beep	The beep is an acoustic signal after each key stroke. <ul style="list-style-type: none"> Normal Normal volume. Loud Increased volume. Off Beep is deactivated.
Sector Beep	<ul style="list-style-type: none"> On Sector Beep sounds at right angles (0°, 90°, 180°, 270° or 0, 100, 200, 300 gon).  <ul style="list-style-type: none"> 1) No beep. 2) Fast beep; from 95.0 to 99.5 gon and 105.0 to 100.5 gon. 3) Permanent beep; from 99.5 to 99.995 gon and from 100.5 to 100.005 gon. Off Sector Beep is deactivated.
Screen ill.	On or Off Sets the screen illumination on or off.
Crossh ill.	Low, Medium or High Sets the illumination level of the crosshairs.
Heating 	<ul style="list-style-type: none"> On The display heater is activated. Off The display heater is deactivated. The display heater is automatically activated when the display illumination is on and the instrument temperature is ≤ 5°C.
Touch	Available for Color&Touch display only. <ul style="list-style-type: none"> On The touch screen is activated. Off The touch screen is deactivated.

Field	Description
	 Press Display to calibrate the touch screen. Follow the instructions on the screen.
Data Output	Sets the location for data storage. Int. Mem. All data is recorded in the internal memory. Interface Data is recorded via the serial interface or the USB device port, depending on the port selected in the COMMUNICATION SETTINGS screen. This Data Output setting is only required if an external storage device is connected and measurements are started at the instrument with MEAS/REC or ALL. This setting is not required if the instrument is totally controlled by a data-logger.
GSI Format	Sets the GSI output format. GSI 8 81..00+12345678 GSI 16 81..00+1234567890123456
Mask	Sets the GSI output mask. Mask1 Pt, HA, VA, sDIST, ppm+mm, TgtHGT, Instr.h. Mask2 Pt, HA, VA, sDIST, E, N, H, TgtHGT.
Code saving	Sets if the codeblock is saved before or after the measurement. Refer to "8 Coding".
Language	Sets the chosen language. The current loaded language(s) are shown. A selected language can be deleted by pressing DelLng . This function is available if more than one language is installed, and the selected language is not the chosen operating language.
Auto-Off	Enable The instrument switches off after 20 minutes without any activity, for example no key pressed or vertical and horizontal angle deviation is $\leq \pm 3^\circ$. Disable Automatic switch-off is deactivated.  Battery discharges quicker.

Tilt and horizontal corrections

Setting		Correction			
Tilt correction	Horizontal correction	Incline longitudinal	Incline transversal	Horizontal collimation	Tilting axis
Off	On	No	No	Yes	Yes
1-Axis	On	Yes	No	Yes	Yes
2-Axis	On	Yes	Yes	Yes	Yes
Off	Off	No	No	No	No
1-Axis	Off	Yes	No	No	No
2-Axis	Off	Yes	No	No	No

5.2

EDM Settings


Description

The settings on this screen define the active EDM, **E**lectronic **D**istance **M**easurement. Different settings for measurements are available with Reflectorless (RL) and Prism (IR) EDM modes.

Access

- 1) Select **Settings** from the **MAIN MENU**.
- 2) Select **EDM** from the **SETTINGS** menu.

EDM SETTINGS

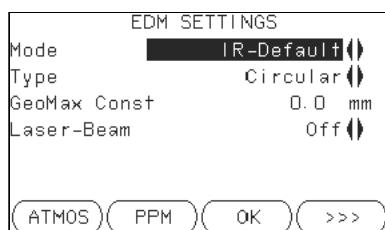

ATMOS

To enter atmospheric data ppm.

PPM

To enter an individual ppm value.

>>> SCALE



To enter projection scale details.

>>> SIGNAL

To view EDM Signal reflection value.

>>> FREQ.

To view the EDM frequency.

Field	Description	
Mode	IR-Default	Fine measuring mode for high precision measurements with prisms.
	IR-Quick	Quick measuring mode with prisms, with higher measuring speed and reduced accuracy.
	IR-Continuous	For continuous distance measurements with prisms.
	Foil	For distance measurements using Retro reflective targets.
	RL-Default	For distance measurements without prisms.
	RL-Continuous	For continuous distance measurements without prisms.
Type	Circular	 Standard prism ZPR100 GeoMax Constant: 0.0 mm
	Custom	The user can define their own prism. Constants can be entered in mm in GeoMax Const:
	JpMini	ZPM100 GeoMax Constant: +34.4 mm
	Foil	 GeoMax Constant: +34.4 mm
	None	RL-modes GeoMax Constant: +34.4 mm
GeoMax Const.	This field displays the GeoMax prism constant for the selected Type : Where Type : is Custom this field becomes editable to set a user defined constant. Input can only be made in mm. Limit value: -999.9 mm to +999.9 mm.	
Laser-Beam	Off	Visible laser beam is deactivated.
	On	Visible laser beam for visualising the target point is activated.

ATMOSPHERIC DATA ENTRY

This screen enables the entry of atmospheric parameters. Distance measurement is influenced directly by the atmospheric conditions of the air in which the measurements are taken. In order to take these influences into consideration distance measurements are corrected using atmospheric correction parameters. The refraction correction is taken into account in the calculation of the height differences and the horizontal distance. Refer to "14.7 Scale Correction" for the application of the values entered in this screen.



When PPM=0 is selected, the GeoMax standard atmosphere of 1013.25 mbar, 12°C, and 60% relative humidity will be applied.

PROJECTION SCALE

This screen enables entry of the scale of projection. Coordinates are corrected with the PPM parameter. Refer to "14.7 Scale Correction" for the application of the values entered in this screen.

Free-PPM Entry

This screen enables the entry of individual scaling factors. Coordinates and distance measurements are corrected with the PPM parameter. Refer to "14.7 Scale Correction" for the application of the values entered in this screen.

EDM SIGNAL REFLECTION

This screen tests the EDM signal strength (reflection strength) in steps of 1%. Enables optimal aiming at distant, barely visible, targets. A percentage bar and a beeping sound, indicate the reflection strength. The faster the beep the stronger the reflection.

5.3

Communication Settings

Description

For data transfer the communication parameters of the instrument must be set.

Access

- 1) Select **Settings** from the **MAIN MENU**.
- 2) Select **Comm** from the **SETTINGS** menu.

COMMUNICATION SETTINGS



BTCode

To set a code for the Bluetooth connection.



This softkey is only available for Zoom30 Pro/Zoom35 Pro instruments. The default Bluetooth code is '0000'.

Field	Description
Port	Instrument port.
	RS232 Communication is via the serial interface.
	USB Communication is via the USB host port.
Bluetooth	Bluetooth Communication is via Bluetooth.
	On Bluetooth sensor is activated.
	Off Bluetooth sensor is deactivated.

The following fields are active only when **Port: RS232** is set.

Field	Description
Baudrate	Speed of data transfer from receiver to device in bits per second. 1200, 2400, 4800, 9600, 14400, 19200, 38400, 57600, 115200
Databits	Number of bits in a block of digital data.
	7 Data transfer is realised with 7 databits.
	8 Data transfer is realised with 8 databits.
Parity	Even Even parity. Available if data bit is set to 7.
	Odd Odd parity. Available if data bit is set to 7.
	None No parity. Available if data bit is set to 8.
Endmark	CR/LF The terminator is a carriage return followed by a line feed.
	CR The terminator is a carriage return.
Stopbits	1 Number of bits at the end of a block of digital data.

6 Tools

6.1 Calibration

Description The **CALIBRATION** menu contains tools to be used for the electronic calibration of the instrument. Using these tools helps to maintain the measuring accuracy of the instrument.

- Access**
- 1) Select **Tools** from the **MAIN MENU**.
 - 2) Select **Calibr.** from the **TOOLS MENU**.
 - 3) Select a calibration option from the **CALIBRATION** screen.

Calibration options In the **CALIBRATION** screen there are several calibration options.

Menu selection	Description
HA-Collimation	Refer to "12.3 Calibrating Line-of-Sight and Vertical Index Error".
Vertical Index	Refer to "12.3 Calibrating Line-of-Sight and Vertical Index Error".
View Calibration Data	Displays the current calibration values that have been set for HA-Collimation and V-index.

6.2 Auto Start Routine

Description Through the Auto Start tool, it is possible to record a user defined sequence of key presses so that, after switching on the instrument, a particular screen can be displayed after the **Level & Plummet** screen instead of the **MAIN MENU**. For example, the general **SETTINGS** screen for configuring the instrument settings.

- Access**
- 1) Select **Tools** from the **MAIN MENU**.
 - 2) Select **Auto St.** from the **TOOLS MENU**.

- Auto start step-by-step**
- 1) Press **REC** in the **AUTO START** screen.
 - 2) Press **OK** to confirm the information message and begin the recording process.
 - 3) The next key presses are stored, up to a maximum of 16. To end the recording press **ESC**.
 - 4) If the auto start **Status:** is set to **On**, the stored key presses will be executed automatically after switching on the instrument.




The automatic start routine has the same effect as pressing the keys manually. Certain instrument settings can not be made in this way. Relative entries such as automatically setting EDM **Mode: IR-Quick** upon switching on the instrument, are not possible.

6.3 System Information

Description The System information screens display instrument, system and firmware information, as well as settings for the date and time.

- Access**
- 1) Select **Tools** from the **MAIN MENU**.
 - 2) Select **SysInfo** from the **TOOLS MENU**.

SYSTEM INFORMATION This screen displays information about the instrument and operating system.

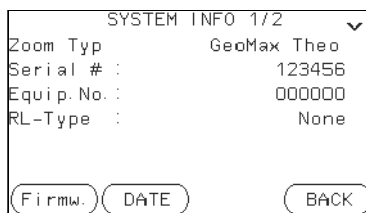


Firmw.
To display details of the firmware package installed on the instrument.

DATE
To change the date and format.

Next step
Press **Firmw.** to view the firmware package information.



Before selecting **FORMAT**, to format the internal memory, ensure that all important data is first transferred to a computer. Jobs, formats, codelists, configuration files, uploaded languages and firmware will be deleted by formatting.

Field	Description
Zoom-FW. Version	Displays the firmware version number installed on the instrument.
Build	Displays the build number of the firmware.
Current Lang	Displays the current language and version number selected for the instrument.
EDM-Firmware	Displays the version number of the EDM firmware.
 Application Information	Displays a list of the applications available on the instrument.

6.4 Loading Software

Description

To load application software or an additional language, connect the instrument to GGO via the serial interface or USB and load using "GGO - Software Upload". Refer to the GGO online help for further information. The software can be loaded via a USB memory stick. This process is described below.

Access

- 1) Select **Tools** from the **MAIN MENU**.
- 2) Select **Load FW** from the **TOOLS MENU**.



Never disconnect the power supply during the system upload process. The battery must be at least 75% capacity before commencing the upload.

Loading firmware and languages step-by-step


1. To load firmware and languages: Select **Firmware**. The **Select File** screen will appear.
To load only languages: Select **Languages only** and skip to step 4.
2. Select the firmware file from the system folder of the USB memory stick. All firmware and language files must be stored in the system folder to be transferred to the instrument.
3. Press **OK**.
4. The **Upload Languages** screen will appear displaying all language files in the system folder of the USB memory stick. Select **Yes** or **No** for a language file to be uploaded. At least one language must be set to **Yes**.
5. Press **OK**.
6. Press **Yes** on the power warning message to proceed and upload the firmware and/or selected languages.
7. Once successfully loaded, the system will shutdown and restart again automatically.

7 Functions

7.1 Overview


Description Functions can be accessed by pressing **FNC** from any measurement screen. **FNC** opens the functions menu and a function can be selected and activated.

Functions

Function	Description
Level & Plummet	Activates the laser plummet and electronic level.
Distance Offset	Refer to "7.2 Distance Offset".
Delete Last Observ.	Deletes the last recorded data block. This can be either a measurement block or a code block.  Deleting the last record is not reversible! Only records recorded in Survey can be deleted.
Code-Library	Starts Coding application to select a code from a codelist or enter a new code. Same functionality like the softkey CODING .
Laserbeam	Activates/deactivates the visible laser beam for illuminating the target point.
Screen ill. On /Off	Activates and deactivates the screen illumination light.
Z-Coordinate	Refer to "7.3 Z-Coordinate".
2 Dist. Offset	Refer to "7.4 2 Dist. Offset".
Brg/Dist	Refer to "7.5 Brg/Dist".
EDM Continuous	Refer to "7.6 EDM Continuous".
Menu	Returns to the MAIN MENU .
Display	To switch the display illumination on/off. Available for Zoom20 Pro.
Touch	To enable/disable touch functionality. Available for Zoom30 Pro/Zoom35 Pro.

7.2 Distance Offset


Description This function calculates the target point coordinates if it is not possible to set up the reflector, or to aim at the target point directly. The offset values (length, trav. and/or height offset) can be entered. The values for the angles and distances are calculated to determine the target point.

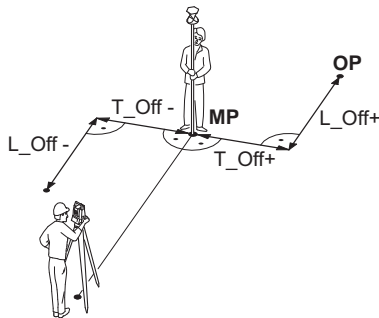

- MP Measurement point
- OP Offset point
- T_Off Length offset
- L_Off Cross offset


- Access**
- 1) Press **FNC** when within any application.
 - 2) Select **Distance Offset** from the **FUNCTIONS** menu.

DIST-OFF

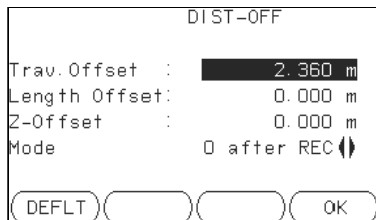

DEFLT
To reset offset values to 0.

Field	Description
Trav. Offset	Perpendicular offset. Positive if the offset point is to the right of the measured point.

Field	Description
Length Offset	Longitudinal offset. Positive if the offset point is further away than the measured point.
Z-Offset	Height offset. Positive if the offset point is higher than the measured point.
Mode	Period for which the offset is to apply. 0 after REC The offset values are reset to 0 after the point is saved. Continuous The offset values are applied to all further measurements.  The offset values are always reset to 0 when the application is quit.

Next step


- Press **OK** to calculate the corrected values and return to the application from which the offset function was started. The corrected angle and distances are displayed as soon as a valid distance measurement has been triggered or exists.

7.3

Z-Coordinate

Description

This function determines the height of the instrument from measurements to a maximum of five target points, with known heights, in two faces. With measurements to several targets, the improvement is indicated in the "d" value.

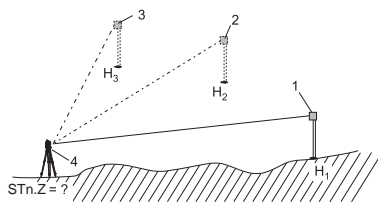

- 1 Reflector 1
- 2 Reflector 2
- 3 Reflector 3
- 4 Instrument

Access

- 1) Press **FNC** when within any application.
- 2) Select **Z-Coordinate** from the **FUNCTIONS** menu.

Z-Coordinate step-by-step


- 1) Select a known point and input the reflector height. Select;
 - **PtHgt**: To enter the height of a fixpoint.
 - **Inst.h.**: To enter the height transfer values for the instrument.
- 2) Press **ALL** to complete the measurement and display the calculated height.
 - **AddTg**: Adds another height of a known point.
 - **FACE**: Measures to the same target in second face.
 - **OK**: Saves the changes and sets the station height.

7.4

2 Dist. Offset

Description

This function is used for measurements to a point that is not directly visible, using a special 2 Dist. Offset pole.

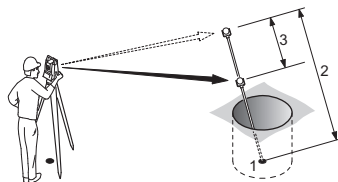

- 1 E, N, H of Target Point
- 2 Pole Length
- 3 Distance P1-P2

Access

- 1) Press **FNC** when within any application.
- 2) Select **2 Dist. Offset** from the **FUNCTIONS** menu.

Next step

If required, press **POLE** to define the pole or EDM settings.

POLE SETTINGS

Field	Description
Mode	Changes the EDM Mode.
Type	Changes the prism type.
GeoMax Const	Displays the prism constant.
Pole Length	Total length of 2 Dist. Offset pole


Field	Description
Dist. P1-P2	Spacing between the centers of the prisms P1 and P2.
Meas. Tol	Limit for the difference between the given and measured spacing of the prisms. If the tolerance value is exceeded, the function will issue a warning.

Next step

In the **2 DIST. OFFSET** screen, measure to the first and second prisms using **ALL** and the **2 DIST. OFFSET RESULT** screen is displayed.

2 DIST. OFFSET RESULT

Displays Easting, Northing and Height coordinates of the target point.

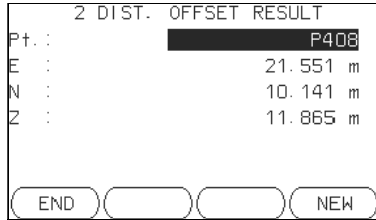

END

To record results and return to application where **FNC** was selected.

NEW

To return to the **2 DIST. OFFSET** screen.

Next step


Press **END** to return to the application where **FNC** was selected.

7.5

Brg/Dist

Description

This function calculates and displays the slope and horizontal distance, height difference, azimuth, grade, and coordinate differences between the last two measured points. Valid distance measurements are required for the calculation.

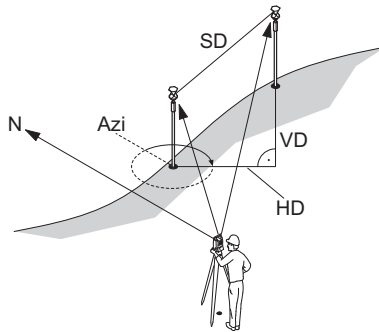

- Azi Azimuth
- SD Slope distance
- VD Height distance
- HD Horizontal distance

Access

- 1) Press **FNC** when within any application.
- 2) Select **Brg/Dist** from the **FUNCTIONS** menu.

CONTROL DISTANCE

Field	Description
Brg	Difference in bearing between the two points.
Grade	Difference in gradient between the two points.
hDIST	Difference in horizontal distance between the two points.
sDIST	Difference in slope distance between the two points.
d.d.Z	Difference in height between the two points.

Messages

The following are important messages or warnings that may appear.

Messages	Description
Less than two valid measurements!	The values cannot be calculated as there are less than two valid measurements.

Next step

Press **OK** to return to the application where **FNC** was selected.

Description

This function activates or deactivates the tracking measurement mode. The new setting is displayed for about one second and then set. The function can only be activated from within the same EDM mode and prism type. The following options are available.

Mode	Off <=> On
IR	IR-Default <=> IR-Continuous / IR-Quick <=> IR-Continuous.
RL	RL-Default <=> RL-Continuous.



The last active measurement mode remains set when the instrument is switched off.

Description

Codes contain information about recorded points. With the help of coding, points can be assigned to a particular group simplifying later processing.
Codes are stored in codelists, with each codelist supporting a maximum of 200 codes.

GSI coding

Codes are always stored as free codes (WI41-49), that means that codes are not directly linked to a point. They are stored before or after the measurement depending on the setting made.
A code is always recorded for each measurement as long as the code is displayed in the **Code:** field. For a code not to be recorded, the **Code:** field must be cleared. This can be set to occur automatically. Refer to "5.1 General Settings".

Access

- Either, select **Survey** from the **MAIN MENU** and press >>> **CODING**.
- Or, press **FNC** when within any application and select **Code Library**.

CODE-LIBRARY

CODE-LIBRARY 1/2

Search/New: 552

Code : 552

Comment : CODEDESC

Text 1 : -----

Text 2 : -----

REC AddLst OK

REC

To record the code without measurement.

AddLst

To add the entered code to the codelist.

Field	Description
Search/New	Code name. After entry, the firmware searches for a matching code name, and displays these in the code field. If a matching code name doesn't exist this value becomes the new code name.
Code	List of existing code names.
Comment	Additional remarks.
Text1 to Text8	More information lines, freely editable. Used to describe attributes of the code.

Extend / edit codes

To each code a description and a maximum of 8 attributes with up to 16 characters each can be assigned. Existing code attributes, displayed in fields **Text 1:** to **Text 8:**, can be overwritten freely with the following exceptions:

The codelist editor of GGO can assign a status to the attributes.

- Attributes with status "fixed" are write-protected. They cannot be overwritten or edited.
- For attributes with status "Mandatory" an input or a confirmation is required.
- Attributes with status "Normal" can be edited freely.

9 Applications - Getting Started

9.1 Overview


Description

Applications are predefined programs, that cover a wide spectrum of surveying duties and facilitate daily work in the field. The following applications are available, although application packages for each instrument may vary from that stated below:

- Survey
- Reference Element
- COGO
- Missing Line Measurement
- Resection
- Set Out
- Area & Volume
- Remote Elevation
- Construction
- Road


9.2 Starting an Application

Access

- 1) Select **Apps** from the **MAIN MENU**.
- 2) Press  to move through the screens of available applications.
- 3) Press a function key, **F1 - F4**, to select the specified application in the **APPS** menu.

Pre-settings screens

Pre-settings for Survey is shown as an example. Any additional settings for particular applications are explained within the chapters for those applications.

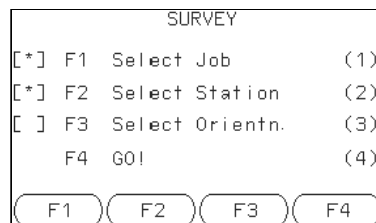

[•] = Setting has been made.
[] = Setting has not been made.

F1-F4
To select menu item.

Field	Description
Select Job	To define the job where data will be saved. Refer to "9.3 Selecting the Job".
Select Station	To define the current position of the instrument station. Refer to "9.4 Selecting the Station".
Select Orientn.	To define the orientation, horizontal direction, of the instrument station. Refer to "9.5 Selecting the Orientation".
Go!	Starts the selected application.

9.3 Selecting the Job


Description

All data is saved in Jobs, like file directories. Jobs contain measurement data of different types, for example measurements, codes, fixed points, or stations. Jobs are individually manageable and can be exported, edited or deleted separately.

Access

Select **Select Job** in **Pre-settings** screen.

SELECT JOB

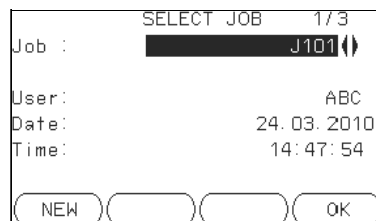

NEW
To create a new job.

Field	Description
Job	Name of an existing job to be used.
User	Name of user, if entered.
Date	Date the selected job was created.
Time	Time the selected job was created.

Next step

- Either, press **OK** to continue with the selected job.
- Or, press **NEW** to open the **NEW JOB** screen and create a new job.

Recorded data

Once a job is set up, all subsequent recorded data will be stored in this job. If no job was defined and an application was started, or if in **Survey** and a measurement was recorded, then the system automatically creates a new job and names it "DEFAULT".

Next step

Press **OK** to confirm the job and return to the **Pre-Settings** screen.


9.4 Selecting the Station

Description

All measurements and coordinate computations are referenced to the set station coordinates. The station coordinates that are set must include:

- at least grid coordinates (E, N), and
- the station height, if required.

The coordinates can be entered manually or selected from the memory.

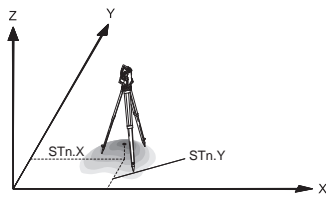

Directions

- X Easting
- Y Northing
- Z Height

Station coordinates

- Stn.X Easting coordinate of station
- Stn.Y Northing coordinate of station

Access

Select **Select Station** in the **Pre-settings** screen.

Station input

Field	Description
Stn	Station name of a previously saved station position.



If no station was set and an application was started, or if in **Survey** and a measurement was recorded, then the last station is set as the current station.

Next step

The **Inst.H** field appears once the station coordinates have been entered. Enter the instrument height if desired and press **OK** to return to the **Pre-Settings** screen.

9.5 Selecting the Orientation

9.5.1 Overview

Description

All measurements and coordinate computations are referenced to the orientation of the set station. The orientation can be entered manually or determined from points that are either measured or selected from the memory.

Access

- Select **Select Orientn.** in the **Pre-settings** screen and choose:
- **Angle** To enter a new bearing. Refer to "9.5.2 Manual Orientation".
 - **Coordinates** To calculate and set the orientation using existing coordinates. A maximum of five target points can be used. Refer to "9.5.3 Orientation with Coordinates".

9.5.2

Manual Orientation

Access

Select **Angle** in the **STN.ORIENTATION** screen.

MANUAL ANGLE SETTING

MANUAL ANGLE SETTING	
Brg. :	0.0000 g
TgtHGT:	1.500 m
BS ID :	301
<input type="button" value="ALL"/> <input type="button" value="REC"/> <input type="button" value="H. A. =0"/> <input type="button" value="EDM"/>	

HA=0

To set **Brg: 0**

Field	Description
Brg	Horizontal direction of the station.
TgtHGT.	Height of the reflector.
BS ID	Point ID of the backsight point.


Next step

- Either, press **ALL** to measure and record the distance and horizontal angles. This will calculate and set the orientation and return to the **Pre-Settings** screen.
- Or, press **REC** to record the horizontal direction only. This will set the orientation and return to the **Pre-Settings** screen.

9.5.3

Orientation with Coordinates

Diagram

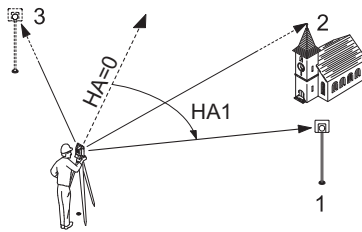

Known coordinates

- 1 Target point
- 2 Target point
- 3 Target point

Calculations

- HA1 Station orientation

Access

Select **Coordinates** in the **STN-ORIENTATION** screen.

Orientation with coordinates

Field	Description
Pt.	Point ID of the backsight point.

Next step

Find an existing backsight point in the pointsearch or enter ENZ coordinates for a new point. Press **OK** to continue to **Sight target point**.

Sight target point

Field	Description
BS ID	Point ID of the selected, or entered backsight point.

Next step

After each measurement the message, **Do you want to take additional measurements** appears.

Selecting:

- **Yes** returns to the **Sight target point** screen to take an additional measurement. A maximum of five target points can be used.
- **No** proceeds to the **STN. ORIENTATION RESULT** screen.

Result calculation

If more than one target point is measured then the orientation is computed using the "least squares method".

IF	THEN
the orientation is only measured in face II	the horizontal direction is based on face II.
the orientation is measured only in face I or a mixture of I and II	the horizontal direction is based on face I.
a target point is measured several times in the same face	the last valid measurement is used for the computation.


Stn. Orientation result

Field	Description
Pts	Number of points used in the calculation.
Stn	Station name for which the orientation has been set.
HA Corr	Horizontal correction
Std.Dev	Standard deviation indicating the potential variance between the true orientation and that calculated.

Next step

- Either, press **Resid** to display the residuals.
- Or, press **OK** to set the orientation and return to the **Pre-Settings** screen.

Stn. Orientation Residuals

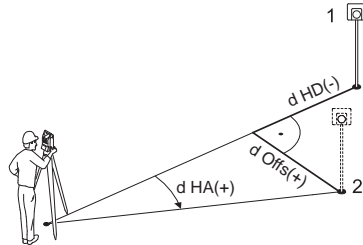

- 1 Actual
- 2 Design
- P2 Target point
- d Offs Height correction
- d HD Correction in horizontal distance
- d HA Correction in horizontal direction

Field	Description
BS ID	Point IDs of the target points used in calculating the orientation.
d.H.A	The difference in horizontal direction to the target point.
d.H.D	The difference in horizontal distance to the target point.
dZ	The difference in height to the target point.



If no orientation was set and an application was started, or if in **Survey** and a measurement was recorded, then the current horizontal direction is set as the orientation.

Next step

Select **GO!** to begin the application.

10

Applications

10.1

Common Fields

Description of fields

The following table describes common fields that are found within the firmware applications. These fields are described here once and not repeated in the application chapters unless the field has a specific meaning within that application.

Field	Description
Pt, Pt 1	Point ID of the point.
TgtHGT	Height of the reflector.
HA	Horizontal direction to the point.
VA	Vertical angle to the point.
hDIST	Horizontal distance to the point.
sDIST	Slope distance to the point.
dHGT	Height to the point.
E	Easting coordinate of the point.
N	Northing coordinate of the point.
Z	Height coordinate of the point.

10.2

Survey

Description

Survey is an application used for the measurement of an unlimited number of points. It is comparable to **Survey** from the **MAIN MENU**, but includes pre-settings for the job, station and orientation prior to beginning a survey.

Access

- 1) Select **Apps** from the **MAIN MENU**.
- 2) Select **Survey** from the **APPS** menu.
- 3) Complete application pre-settings. Refer to "9 Applications - Getting Started".

SURVEY

SURVEY 1/3 Circular

Pt. : P401 1

TgtHGT : 1.500 m

Comment : -----

H. A. : 25.7000 g

V. A. : 83.2300 g

sDIST : 26.000 m

[ALL] [MEAS] [REC] [>>>]

>>> **I Pt**

To switch between individual and current point numbers.

>>> **CODING**

To find/enter codes. Refer to "8 Coding".

Field	Description
Comment / Code	<p>Comment or Code name depending on the coding method. Two coding methods are available:</p> <ol style="list-style-type: none"> 1) Comment coding: This text is stored with the corresponding measurement. The code is not related to a codelist, it is just a simple comment. A codelist on the instrument is not necessary. 2) Expanded coding with codelist: Press >>> CODING. The code that was entered is searched for within the code list and it is possible to add attributes to the code.

Next step

- Either, press **ALL** to record another point.
- Or, press **ESC** to exit the application.

10.3

Reference Element - Reference Line

10.3.1

Overview

Description

Reference Element - Line is an application that facilitates the easy set out or checking of lines, for example, for buildings, sections of road, or simple excavations. It allows the user to define a reference line and then complete the following tasks with respect to that line:

- Line & offset
- Set out points

Access

- 1) Select **Apps** from the **MAIN MENU**.
- 2) Select **Reference Element** from the **APPS** menu.
- 3) Complete application pre-settings. Refer to "9 Applications - Getting Started".
- 4) Select **Line**

Next step

Define the base line for the reference line.

10.3.2


Defining the Base Line

Description

A reference line can be defined by referencing a known base line. The reference line can be offset either longitudinally, in parallel or vertically to the base line, or be rotated around the first base point as required. Furthermore the reference height can be selected as the first point, second point or interpolated along the reference line.

Define the base line

The base line is fixed by two base points. All points can be either measured, manually entered, or selected from the memory.

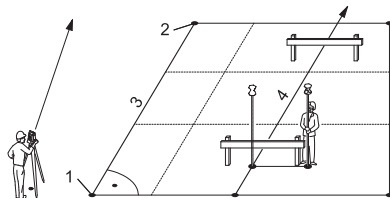

- 1 1st base point
- 2 2nd base point
- 3 Base line
- 4 Reference line

Define the base line by measuring or selecting the start and end points of the line.

Next step

After defining the base line the **REFERENCE LINE** screen will appear for defining the reference line.


10.3.3

Defining the Reference Line

Description

The base line can be offset from, either longitudinally, in parallel or vertically, or be rotated around the first base point. This new line created from the offsets is called the reference line. All measured data refers to the reference line.

Reference line

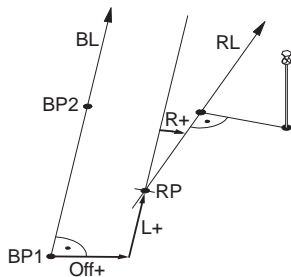


- BP Base point
- BL Base line
- RP Reference point
- RL Reference line
- Off Parallel offset
- L Longitudinal offset
- R Rotation parameter

Access

After completing the measurements required for defining the base line, the **REFERENCE LINE** screen will appear.

REFERENCE LINE

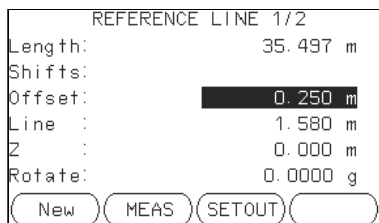

New

To define a new base line.

MEAS

To measure Line & Offset.

SETOUT

To set out points orthogonal to the reference line.

Field	Description
Length	Length of the base line.
Offset	Parallel offset of the reference line relative to the base line (P1-P2). Positive values are to the right of the base line.

Field	Description
Line	Longitudinal offset of the start point, reference point (P3), of the reference line in the direction of base point 2. Positive values are towards base point 2.
Z	Height offset of the reference line to the selected reference height. Positive values are higher than the selected reference height.
Rotate	Rotation of the reference line clockwise around the reference point (P3).
Ref.Hgt	<p>Pt. 1 Height differences are computed relative to the height of the first reference point.</p> <p>Pt. 2 Height differences are computed relative to the height of the second reference point.</p> <p>Interpolated Height differences are computed along the reference line.</p> <p>w/o. Height Height differences are not computed or shown.</p>

Next step


Select a softkey option, **MEAS** or **SETOUT** to proceed to a subapplication.

10.3.4

Subapplication Measure Line & Offset


Description

The Measure Line & Offset subapplication calculates from measurements or coordinates, longitudinal offsets, parallel offsets and height differences of the target point relative to the reference line.

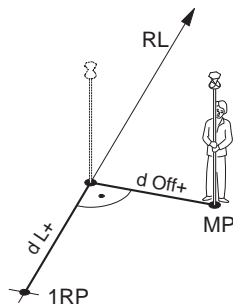

- RL Reference line
- 1RP Start point
- MP Measured point
- dL Longitudinal offset
- dOff Parallel offset

Example of height difference relative to first reference point

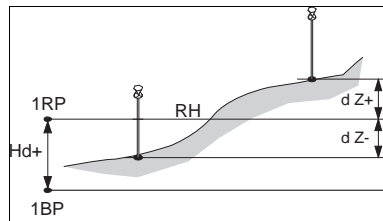

- 1RP 1st reference point
- 1BP 1st base point
- RH Reference height
- Hd Height difference between reference and base point
- dZ Height difference from reference height

Access

Press **MEAS** in the **REFERENCE LINE** screen.

Measure

Field	Description
d Line	Calculated distance longitudinal to the reference line.
d Offset	Calculated distance perpendicular from the reference line.
d.d.Z	Calculated height difference relative to the defined reference height.

Next step

- Either, press **ALL** to measure and record.
- Or, press **>>> BACK** to return to the **REFERENCE LINE** screen.


10.3.5

Subapplication Setout

Description

The setout subapplication calculates the difference between a measured point and the calculated point. The orthogonal (dLine, dOffset, d.d.Z) and polar (dHA, d.hDIST, d.d.Z) differences are displayed.

Example orthogonal setout

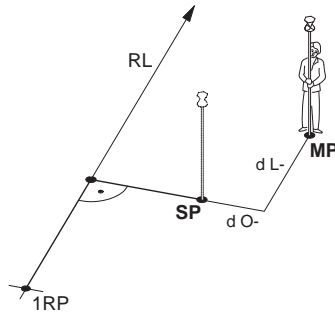

- 1RP 1st reference point
- SP Set out point
- MP Measured point
- RL Reference line
- dL Longitudinal offset
- dO Parallel offset

Access

Press **SETOUT** from the **REFERENCE LINE** screen.

SETOUT

Enter the set out elements for the target points to be set out relative to the reference line.


Field	Description
Line	Longitudinal offset: Positive if set out point is further away from the reference line.
Offset	Perpendicular offset: Positive if set out point is to the right of the reference line.
Z	Height offset: Positive if set out point is higher than the reference line.

Next step

Press **OK** to proceed to measurement mode.

SET OUT

The signs for the distance and angle differences are correction values (required minus actual). The arrows indicate the direction to move to get to the set out point.

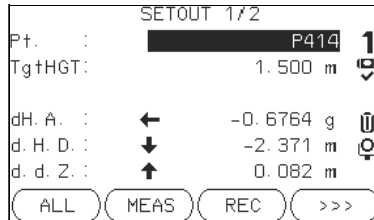

>>> **NextPt**

To add the next point to be set out.

Field	Description
d HA	Horizontal direction from the measured point to the set out point. Positive if the telescope must be turned clockwise to the set out point.
d.H.D	Horizontal distance from the measured point to the set out point. Positive if the set out point is further away than the measured point.
d.d.Z	Height difference from the measured point to the set out point. Positive if the set out point is higher than the measured point.
dOffset	Perpendicular distance from the measured point to the set out point. Positive if the set out point is to the right of the measured point.
dLine	Longitudinal distance from the measured point to the set out point. Positive if the set out point is further away than the measured point.

Messages

The following are important messages or warnings that may appear.

Messages	Description
Base line too short !	Base line is shorter than 1 cm. Choose base points such that the horizontal separation of both points is at least 1 cm.
Coordinates invalid !	No coordinates or invalid coordinates for a point. Ensure that points used have at least Easting and Northing coordinates.

Next step

- Either, press **ALL** to measure and record.
- Or, press >>> **BACK** to return to the **REFERENCE LINE** screen.
- Or, continue selecting **ESC** to exit the application.

10.4 Reference Element - Reference Arc

10.4.1 Overview

Description The Reference Element - Arc application allows the user to define a reference arc and then complete the following tasks with respect to the arc:

- Line & offset
- Set out (Point, Arc, Chord, Angle)


Access

- 1) Select **Apps** from the **MAIN MENU**.
- 2) Select **Reference Element** from the **APPS** menu.
- 3) Complete application pre-settings. Refer to "9 Applications - Getting Started".
- 4) Select **Arc**.

Next step Define the reference arc.

10.4.2 Defining the Reference Arc

Description The reference arc can be defined by a center point and start point, or a start point, end point, and radius. All points can be either measured, manually entered, or selected from the memory.

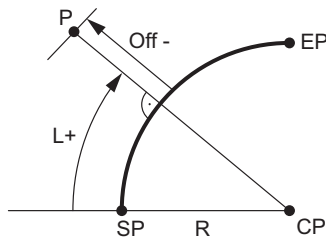

SP Start point
 EP End point
 CP Center point
 R Radius of arc
 L Distance from start of arc, following curve
 Off Perpendicular distance from arc



All arcs are defined in a clockwise direction and all calculations are made in two dimensions.

Access Select **Arc** and then the method to define the arc by:

- **Start-/ Centre Pt.**
- **Start-/ End Pt/ Rad.**

Reference Arc - Measure to start point

Field	Description
Start Pt	Point ID of the start point.
C-Pt	Point ID of the center point.
End Pt	Point ID of the end point.
Radius	Radius of the arc.

Next step After defining the reference arc the **REFERENCE ARC** screen will appear.

REFERENCE ARC

```

REFERENCE ARC
StartPt:      P410
EndPt :      P411
CtrPt :      -----
Radius :      32.000 m

(New) ( ) (MEAS) (SETOUT)
    
```

New
 To define a new base arc.

MEAS
 To measure Line & Offset.

SET OUT
 To set out.

Next step Select a softkey option, **MEAS** or **SET OUT**, to proceed a subapplication.

10.4.3 Subapplication Measure Line & Offset

Description The Measure Line & Offset subapplication calculates from measurements or coordinates, longitudinal and orthogonal offsets and height differences of the target point relative to the reference arc.

Access

Press **MEAS** from the **REFERENCE ARC** screen.

Measure

Field	Description
dLine	Calculated distance longitudinal to the reference arc.
dOffset	Calculated distance perpendicular from the reference arc.
d.d.Z	Calculated height difference relative to the start point of reference arc.

Next step

- Either, press **ALL** to measure and record.
- Or, press >>> **BACK** to return to the **REFERENCE ARC** screen.


10.4.4**Subapplication Setout****Description**

The setout subapplication calculates the difference between a measured point and the calculated point. The reference arc application supports four ways to set out:

- Set out point
- Set out arc
- Set out chord
- Set out angle

Set out point


To set out a point by entering a line and an offset value.

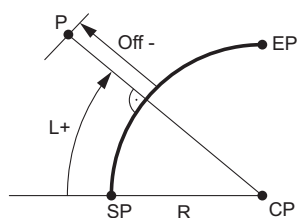

- CP Center point of arc
- SP Start point of arc
- EP End point of arc
- P Set out point
- R Radius of arc
- L Line offset
- Off Perpendicular offset

Set out arc


To set out a series of equidistant points along the arc.

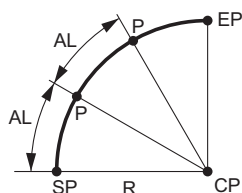

- CP Center point of arc
- SP Start point of arc
- EP End point of arc
- P Set out point(s)
- R Radius of arc
- AL Arc length

Set out chord


To set out a series of equidistant chords along the arc.

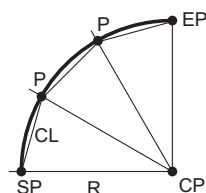

- CP Center point of arc
- SP Start point of arc
- EP End point of arc
- P Set out point(s)
- R Radius of arc
- CL Chord length

Set out angle

To set out a series of points along the arc defined by the angle segments from the center point of the arc.

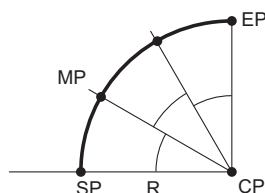

- CP Center point of arc
- SP Start point of arc
- EP End point of arc
- MP Measured point
- R Radius of arc
- b Central angle

Access

- 1) Press **SET OUT** from the **REFERENCE ARC** screen.
- 2) Select one of the four methods of set out available.

Set out point, arc, chord or angle

Enter the set out values. Press **PrevPt/NextPt** to toggle through the calculated set out points.


Field	Description
Distrib.	For set out arc: Method of misclosure distribution. If the entered arc length is not an integer of the whole arc, there will be a misclosure. None All of the misclosure will be added to the last arc-section. Equal The misclosure will be equally distributed between all sections. Start Arc All of the misclosure will be added to the first arc-section.
Arc Length	For set out arc: The length of the arc-segment to set out.
Chord Length	For set out chord: The length of the chord to set out.
Angle	For set out angle: The angle around the center point of the arc, of the points to be set out.
Line	For set out arc, chord and angle: Longitudinal offset from the reference arc. This is calculated by the arc length, chord length or angle and the selected misclosure distribution. For set out point: Longitudinal offset from the reference arc.
Offset	Perpendicular offset from the reference arc.

Next step

Press **OK** to proceed to measurement mode.

REFERENCE ARC - SET OUT

The signs for the distance and angle differences are correction values (required minus actual). The arrows indicate the direction to move to get to the set out point.

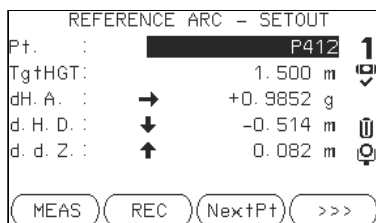

NextPt

To add the next point to be set out.

Field	Description
d HA	Horizontal direction from the measured point to the set out point. Positive if the telescope must be turned clockwise to the set out point.
d.H.D	Horizontal distance from the measured point to the set out point. Positive if the set out point is further away than the measured point.
d.d.Z	Height difference from the measured point to the set out point. Positive if the set out point is higher than the measured point.

Next step

- Either, press >>> **ALL** to measure and record.
- Or, press >>> **BACK** to return to the **REFERENCE ARC** screen.
- Or, continue selecting **ESC** to exit the application.

10.5

COGO

10.5.1

Starting COGO

Description

COGO is an application used to perform **coordinate geometry** calculations such as, coordinates of points, bearings between points and distances between points
The COGO calculation methods are:

- Inverse and Traverse
- Intersections
- Offset
- Extension

Access

- 1) Select **Apps** from the **MAIN MENU**.
- 2) Select **COGO** from the **APPS** menu.
- 3) Complete application pre-settings. Refer to "9 Applications - Getting Started".
- 4) Select from the **COGO MAIN MENU**:
 - **Inverse & Traverse**
 - **Intersection**
 - **Offset**
 - **Extension**

10.5.2


Inverse and Traverse

Access

- 1) Select **Inverse & Traverse** from the **COGO MAIN MENU**.
- 2) Select **Inverse** or **Traverse**.

Inverse

Use the inverse subapplication to calculate the distance, direction, height difference and grade between two known points.

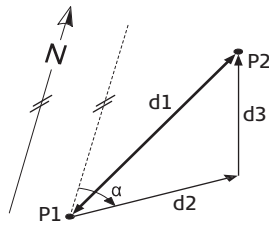

Known


- P1 First known point
- P2 Second known point

Unknown

- α Direction from P1 to P2
- d1 Slope distance between P1 and P2
- d2 Horizontal distance between P1 and P2
- d3 Height difference between P1 and P2

Traverse

Use the traverse subapplication to calculate the position of a new point using the bearing and the distance from a known point. Offset optional.

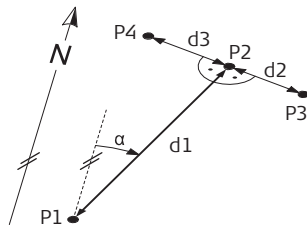

Known

- P1 Known point
- α Direction from P1 to P2
- d1 Distance between P1 and P2
- d2 Positive offset to the right
- d3 Negative offset to the left

Unknown

- P2 COGO point without offset
- P3 COGO point with positive offset
- P4 COGO point with negative offset

10.5.3


Intersections

Access

- 1) Select **Intersection** from the **COGO MAIN MENU**.
- 2) Select the desired COGO method:
 - **Brg-Brg**
 - **Brg-Dst**
 - **Dst-Dst**
 - **Ln-Ln**

Bearing-Bearing

Use the bearing-bearing subapplication to calculate the intersection point of two lines. A line is defined by a point and a direction.

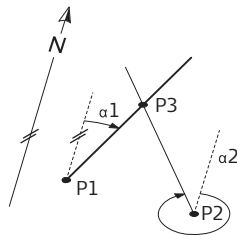

Known


- P1 First known point
- P2 Second known point
- $\alpha1$ Direction from P1 to P3
- $\alpha2$ Direction from P2 to P3

Unknown

- P3 COGO point

Bearing-Distance

Use the bearing-distance subapplication to calculate the intersection point of a line and a circle. The line is defined by a point and a direction. The circle is defined by the center point and the radius.

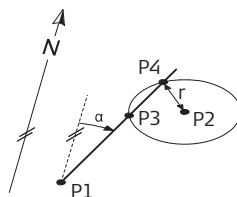

Known


- P1 First known point
- P2 Second known point
- α Direction from P1 to P3 and P4
- r Radius, as the distance from P2 to P4 or P3

Unknown

- P3 First COGO point
- P4 Second COGO point

Distance-Distance

Use the distance-distance subapplication to calculate the intersection point of two circles. The circles are defined by the known point as the center point and the distance from the known point to the COGO point as the radius.

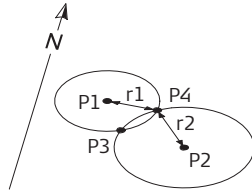

Known

P1 First known point

P2 Second known point

r1 Radius, as the distance from P1 to P3 or P4

r2 Radius, as the distance from P2 to P3 or P4


Unknown

P3 First COGO point

P4 Second COGO point

By Points

Use the line-line subapplication to calculate the intersection point of two lines. A line is defined by two points.

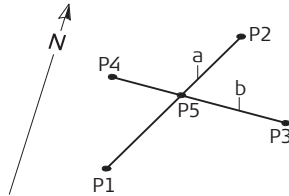

Known

P1 First known point

P2 Second known point

P3 Third known point

P4 Fourth known point

a Line from P1 to P2

b Line from P3 to P4

Unknown

P5 COGO point

10.5.4

Offsets

Access


- 1) Select **Offset** from the **COGO MAIN MENU**.
- 2) Select the desired COGO method:

• **DistOff**

• **Set Pt**

Distance - Offset

Use the distance-offset subapplication to calculate the distance and offset of a known point, with the base-point in relation to a line.

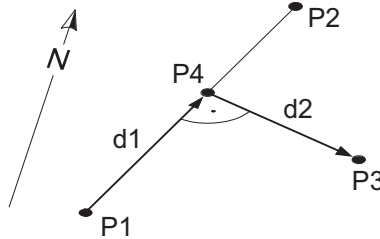

Known

P0 Instrument station

P1 Start point

P2 End point

P3 Offset point

Unknown


d1 d Line

d2 d Offset

P4 COGO (base) point

Set point by....

Use the set point subapplication to calculate the coordinates of a new point in relation to a line from known longitudinal and offset distances.

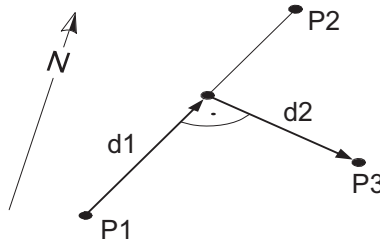

Known

P0 Instrument station

P1 Start point

P2 End point

d1 d Line

d2 d Offset

Unknown

P3 COGO point

10.5.5


Extension

Access

Select **Extension** from the **COGO MAIN MENU**.

Extension

Use the Extension subapplication to calculate the extended point from a known base line.

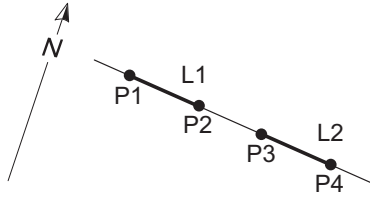

Known

P1 Baseline start point
P3 Baseline end point
dL1,dL2 Distance

Unknown

P2, P4 Extended COGO points

10.6

Missing Line Measurement

Description


Missing Line Measurement is an application used to compute slope distance, horizontal distance, height difference and azimuth of two target points which are either measured, selected from the memory, or entered using the keypad.

Missing Line Measurement methods

The user can choose between two different methods:


- Polygonal: P1-P2, P2-P3, P3-P4.
- Radial: P1-P2, P1-P3, P1-P4.

Polygonal method

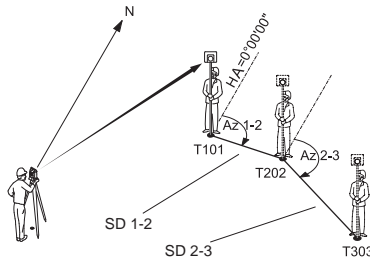

T101 1st target point
T202 2nd target point
T303 3rd target point
SD 1-2 Slope distance from T101-T202
SD 2-3 Slope distance from T202-T303
Az 1-2 Azimuth from T101-T202
Az 2-3 Azimuth from T202-T303

Radial method

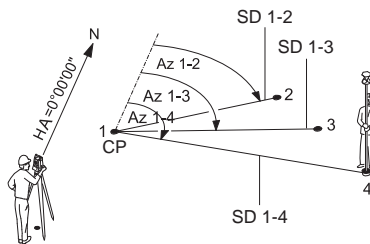

1-4 Target points
SD 1-2 Slope distance from 1-2
SD 1-3 Slope distance from 1-3
SD 1-4 Slope distance from 1-4
Az 1-2 Azimuth from 1-2
Az 1-3 Azimuth from 1-3
Az 1-4 Azimuth from 1-4
CP Center point

Access

- 1) Select **Apps** from the **MAIN MENU**.
- 2) Select **Missing Line Meas.** from the **APPS** menu.
- 3) Complete application pre-settings. Refer to "9 Applications - Getting Started".
- 4) Select **Polygonal** or **Radial**.

Missing line measurements

After completing the measurements required, the **MLM RESULT** screen will appear.

MISSING LINE RESULT - Polygonal method

MISSING LINE RESULT			
Pt 1 :			415
Pt 2 :			416
Brg. :		136.9985	g
Grade :	1.000:	0.029	h:v
d.H.D. :		3.532	m
d.S.D. :		3.533	m
d.d.z. :		0.104	m
NewPt1 NewPt2 <input type="text"/> RADIAL			

NewPt 1

To calculate an additional line. Application starts again at point 1.

NewPt 2

To set point 2 as the starting point of a new line. A new point 2 must be measured.

RADIAL

To switch to radial method.

Field	Description
Brg	Azimuth between point 1 and point 2.
Grade	Grade [%] between point 1 and point 2.
d.H.D	Horizontal distance between point 1 and point 2.
d.S.D	Slope distance between point 1 and point 2.
d.d.Z	Height difference between point 1 and point 2.

Next step

Press **ESC** to exit the application.

10.7


Resection

10.7.1

Starting Resection

Description

Resection is an application used to determine the instruments position from measurements to known points. A minimum of two known points and a maximum of 5, can be used to determine the position.

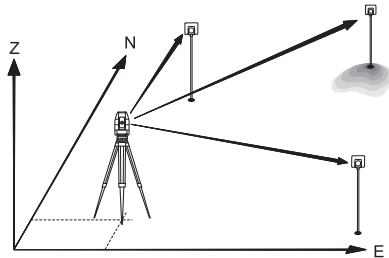

Access

- 1) Select **Apps** from the **MAIN MENU**.
- 2) Select **Resection** from the **APPS** menu.
- 3) Complete application pre-settings. Refer to "9 Applications - Getting Started".
- 4) **Select Accuracy Limit:**
 - **Status: On** to activate a warning message if the calculated standard deviation exceeds the limit.
 - Set the accuracy limits for the Easting, Northing and Height coordinates and the standard deviation angle.
 - Press **OK** to save the limits and return to the **Pre-settings** screen.
- 5) Select **GO!** to begin the application.

Enter target data

Enter the name of the station and the height of the instrument in the **Station data** screen and press **OK**.

Next step

To access the **Sight target point** screen:


- Either, press **OK** after entering the target data fields in the **Target data** screen.
- Or, press **>>> SKIP** to skip entering the target data fields again when measuring the same point in another face.

Sight target point

In the **Sight target point** screen:

2 / I: Indicates that the second point was measured in face I.

2 / I II: Indicates that the second point was measured in faces I and II.

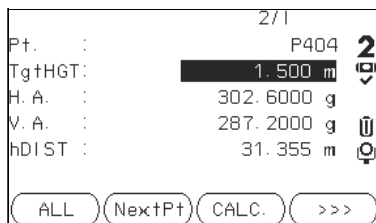

CALC.

To calculate and display the station coordinates, if at least two points and a distance were measured.

NextPt

To return to the **Enter target data** screen to select the next known point.

Next step

- Either, press **NextPt** to measure the next known point.
- Or, press **CALC.** to calculate the station position.

10.7.2

Measuring Information

Measurement sequences

The following measurement sequences are possible:

- Horizontal direction and vertical-angles only (resection)
- Distance and horizontal direction and vertical-angle
- Horizontal direction and vertical-angles to some point(s) and horizontal direction and vertical angles plus distance to other point(s).

Single face I, single face II, or dual face I and II measurements are always possible. No specific point sequence or specific face sequences are required.

Dual face measurements

When measuring the same target in both faces, the reflector height may not be changed when observing in the second face. Error checks are made for dual face measurements to ensure the same point is sighted with the other face.



If a target point is measured several times in the same face, only the last valid measurement is used for computation.

Measurements not included in computations

Target points with 0.000 height are discarded for height processing. If a target point has a valid height of 0.000 m, use 0.001 m to include it for height processing.

10.7.3

Computation Procedure

Description

The measuring procedure automatically determines the method of evaluation, for example resection or three point resection.

If more than the minimum required measurements are performed, the procedure uses a least squares adjustment to determine the 3D position and averages orientation and height measurements.

- The original averaged face I and face II measurements are used for the computation process.
- All measurements are treated with the same accuracy, whether these are measured in single or dual face.
- Easting and Northing are determined by the least squares method, which includes standard deviation and improvements for horizontal direction and horizontal distances.
- The final height (H) is computed from averaged height differences based on the original measurements.
- The horizontal direction is computed with the original averaged face I and face II measurements and the final computed plan position.

10.7.4

Resection Results

Access

Press **CALC.** from the **Sight target point** screen after at least two points and a distance have been measured.

STATION COORDINATES

This screen displays calculated station coordinates. The final computed results are Easting, Northing and Height coordinates of the present instrument station, including the instrument height. Standard deviations and residuals for accuracy assessments are provided.

STATION COORDINATES	
Stn :	S201
Inst. H:	1.400 m
Stn. E :	-0.000 m
Stn. N :	-0.000 m
Stn. Z :	0.000 m

BACK RESID StdDev OK

RESID

To display residuals. Refer to "Target Residuals".

StdDev

To display the standard deviation of the coordinates and angle.



If the instrument height was set to 0.000 in the setup screen, then the station height refers to the height of the tilting axis.

Next step

Press **RESID** to display the target residuals.

Target Residuals

The **TARGET RESIDUALS** screen displays the computed residuals for the horizontal and vertical distances and the horizontal direction. Residual = Calculated value - Measured value.

Messages

The following are important messages or warnings that may appear.

Messages	Description
Selected point has no valid data!	This message occurs if the selected target point has no Easting or Northing coordinate.
Max 5 points supported!	5 points have already been measured and another point is selected. The system supports a maximum of 5 points.
Invalid data - no position computed!	The measurements may not allow final station coordinates (Eastings, Northings) to be computed.
Invalid data - no height computed!	Either the target height is invalid or insufficient measurements are available to compute a final station height.
Remeasure point in Face I and II!	This error occurs if a point was measured in one face and the measurement in the other face differs by more than $180^\circ \pm 0.9^\circ$ for the horizontal or vertical angle.
More points or distance required!	There is insufficient data measured to be able to compute a position. Either there are not enough points used or not enough distances measured.

Next step

Press **OK** to return to the **APPS** menu.

10.8

Set Out


Description

Set Out is an application used to place marks in the field at predetermined points. These predetermined points are the points to be staked. The points to be staked may already exist in a job on the instrument, or be manually entered. The application can continuously display differences, between current position and desired set out position.

Set Out modes


Points can be staked using different modes: Polar mode, Orthogonal to station mode and Cartesian mode.

Polar Set Out mode

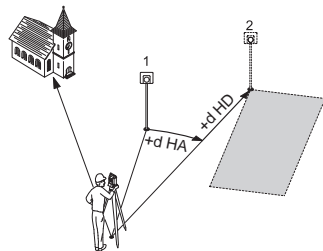


- 1 Current position
- 2 Point to be set out
- dHD Longitudinal offset: positive if point to be setout is further away.
- dHA Angle offset: positive if point to be setout is to the right of the actual direction.

Orthogonal to Station Set Out mode

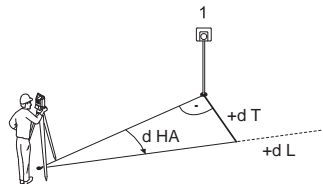

- 1 Current position
- 2 Point to be set out
- dL Longitudinal offset: positive if nominal point is further away.
- dT Transversal offset, perpendicular to line-of-sight: positive if nominal point is to the right of the measured point.
- dHA Angle offset: positive if nominal point is to the right of the actual direction.

Cartesian Set Out mode

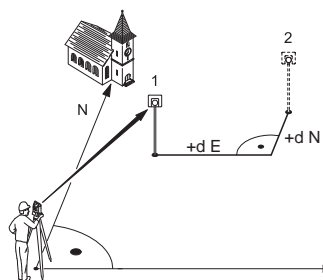


- 1 Current position
- 2 Point to be set out
- d E Easting offset between point to be set out and actual point.
- d N Northing offset between point to be set out and actual point.

Access

- 1) Select **Apps** from the **MAIN MENU**.
- 2) Select **Set Out** from the **APPS** menu.
- 3) Complete application pre-settings. Refer to "9 Applications - Getting Started".

SET OUT

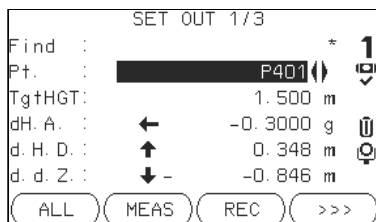


>>> MANUAL

To manually enter coordinates of a point.

>>> B&D

To enter the direction and horizontal distance to a set out point.



Press  to move through the pages. The bottom three measurement fields on the screen will change for the Polar, Orthogonal or Cartesian modes.

Field	Description
Find	Value for Point ID search. After entry, the firmware searches for matching points, and displays these in Pt : If a matching point doesn't exist the pointsearch screen opens.
d HA	Angle offset: Positive if set out point is to the right of the measured point.
d.H.D	Horizontal offset: Positive if set out point is further away than the measured point.
d.d.Z	Height offset: Positive if set out point is higher than the measured point.
dLength	Longitudinal offset: Positive if set out point is further away than the measured point.
dTrav.	Perpendicular offset: Positive if set out point is to the right of the measured point.
dE	Easting offset: Positive if set out point is to the right of the measured point.
dN	Northing offset: Positive if set out point is further away than the measured point.
dZ	Height offset: Positive if set out point is higher than the measured point.

Next step


- Either, press **ALL** to record measurements for a set out point.
- Or, press **ESC** to exit the application.

10.9

Area & Volume

Description

Area is an application used to compute online areas to a maximum of 50 points connected by straights. The target points have to be measured, selected from memory, or entered via the keypad in a clockwise direction. The calculated area is projected onto the horizontal plane (2D) or projected onto the sloped reference plane defined by three points (3D). Furthermore a volume with constant height can be calculated in relation to the area (2D/3D).

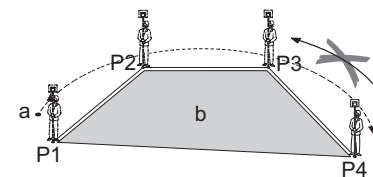

P0 Instrument station

P1 Start point

P2-4 Target points

a Perimeter, polygonal length from start point to the current measured point.


b Calculated area always closed to the start point P1, projected onto the horizontal plane.

Access

- 1) Select **Apps** from the **MAIN MENU**.
- 2) Select **Area & Volume** from the **APPS** menu.
- 3) Complete application pre-settings. Refer to "9 Applications - Getting Started".

AREA & VOLUME

The graphic always shows the area projected onto the horizontal plane.

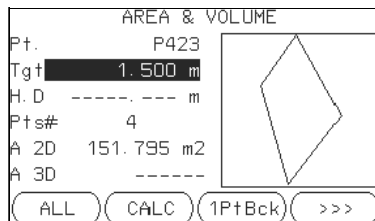

1PtBACK

To undo measurement or selection of the previous point.

CALC

To display and record additional results (perimeter, volume).

>>> VOLUME

To calculate a volume with constant height. The heights have to be entered or measured.


>>> Def. 3D

To define the sloped reference plane by selecting or measuring three points.



The 2D area is calculated and displayed once three points have been measured or selected. The 3D area is calculated once the sloped reference plane is defined by three points.

Graphical representation

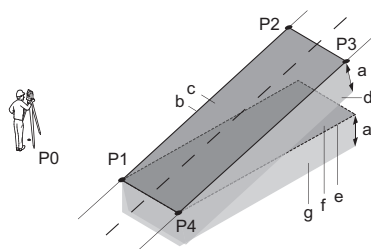

P0 Instrument station

P1 Target point which defines the sloped reference plane

P2 Target point which defines the sloped reference plane

P3 Target point which defines the sloped reference plane

P4 Target point

a Constant height

b Perimeter (3D), polygonal length from the start point to the current measured point of the area (3D)

c Area (3D), projected onto the sloped reference plane

d Volume (3D) = $a \times c$

e Perimeter (2D), polygonal length from the start point to the current measured point of the area (2D)



f Area (2D), projected onto the horizontal plane

g Volume (2D) = $f \times a$

Next step

Press **CALC** to calculate area and volume and proceed to the **Area & Volume Result** screens.

2D/3D-AREA & VOLUME RESULT

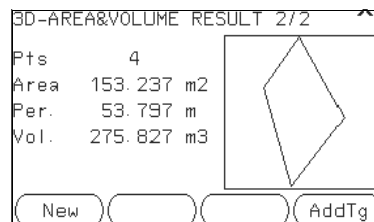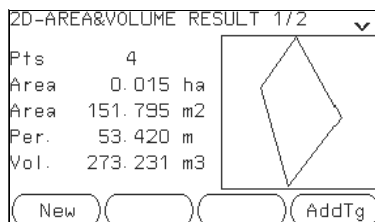

Perimeter and volume are updated if further area points are added.

Next step


- Either, press **New** to define a new area.
- Or, press **AddTg** to add a new target point to the existing area.
- Or, press **ESC** to exit the application.

10.10

Remote Elevation

Description

Remote Elevation is an application used to compute points directly above the base prism without a prism at the target point.

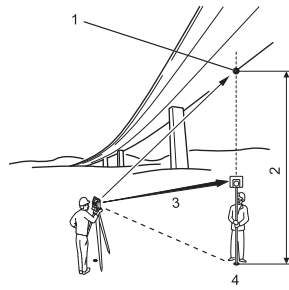

- 1 Remote point
- 2 Height difference
- 3 Slope distance
- 4 Base point

Access

- 1) Select **Apps** from the **MAIN MENU**.
- 2) Select **Remote Elevation** from the **APPS** menu.
- 3) Complete application pre-settings. Refer to "9 Applications - Getting Started".

Remote elevation measurement

Measure to the base point or press $\rightarrow \rightarrow \rightarrow$ **Tgt.H=?** to determine an unknown reflector height.

Next step

After measuring, the **REMOTE ELEVATION** screen appears.

REMOTE ELEVATION - Aim at remote point

Aim the instrument at the inaccessible remote point.

Field	Description
hDIST	Height difference between the base point and the remote point.
Z	Height of the remote point.
d.d.Z	Calculated difference in Height between the base point and the remote point.

Next step

- Either, press **OK** to save the measurement of the remote point.
- Or, press **BACK** to enter and measure a new base point.
- Or, press **ESC** to exit the application.

10.11

Construction

10.11.1

Starting Construction

Description

Construction is an application used to define a construction site by combining set-up of the instrument along a construction line, measuring and setting out points in relation to the line.

Access

- 1) Select **Apps** from the **MAIN MENU**.
- 2) Select **Construction** from the **APPS** menu.
- 3) Select **Set EDM:** to set the EDM settings. Refer to "5.2 EDM Settings".
- 4) Select:
 - **New line** - To define a new construction site, or
 - **Continue with line** - To continue with a previous construction site (skips set-up).



If coordinates were entered by **COORD** and measured to known points, a plausibility check displays the calculated line length, the actual length and the difference.

Next step

Measure to the line start and end points and the **LAY-OUT** screen appears.

10.11.2

Layout

Description

Search or enter points for setting out relative to the defined construction line. The on-screen graphics show the position of the prism relative to the set out point. Below the graphic, the exact values are displayed, combined with arrows to show the direction for setting out the point.



- Be aware that the line start point and the line end point are measured in the previous coordinate system. When setting out these points they appear in the old system and appear as shifted.
- During use of the application the previous orientation and station parameters will be replaced by the new calculated ones. The line start point will be set to E=0, N=0.
- The height of the line start point is always used as the reference height!

Access

- Either, select **New line** from the Construction pre-settings screen and measure start and end points of the line.
- Or, select **Continue with line** from the Construction pre-settings screen.

LAY-OUT

The graphics are scaled to give a better overview. Therefore it is possible that the set out point moves in the graphic.

LAY-OUT	
Pt. :	P404
tgt. :	1.500 m
dLi :	-1.280 m
dOf :	31.329 m
d HG :	-6.491 m
	↑ 0.191 m
	← 0.081 m
	↑ 1.599 m
(MEAS) (REC) (AsBLT) (>>>)	

AsBLT

To switch to AsBuilt mode to check points relative to the construction line.

>>> Shift

To enter values for shifting the line.

Field	Description
dLi	Longitudinal offset: Positive if target point is further away than the measured point.
dOf	Perpendicular offset: Positive if target point is to the right of the measured point.
d HG	Height offset: Positive if target point is higher than the measured point.

Next step

- Either, press **AsBLT** to check point locations relative to a construction line.
- Or, press >>> **Shift** to enter offset values for shifting the construction line.

10.11.3

As Built Check

Description

The As built screen displays the Line, Offset and d.d.Z of a measured point in relation to the construction line. The on-screen graphics show the position of the measured point relative to the construction line.



The height of the line start point is always used as the reference height!

Access

Press **AsBLT** from the **LAY OUT** screen.

AS-BUILT CHECK

The graphics are scaled to give a better overview. Therefore it is possible that the station point moves in the graphics.

AS-BUILT CHECK	
Pt. :	P426
tgt. H:	1.500 m
dLi :	
dOf :	
d HGT:	-0.521 m
(ALL) (Shift) (LAYOUT) (>>>)	

LAYOUT

To switch to Layout mode to set out points.


Shift

To enter values for shifting the line.

Field	Description
dLi	Longitudinal offset: Positive if measured point is further along the construction line from the start point.
dOf	Perpendicular offset: Positive if measured point is to the right of the construction line.
d HGT	Calculated difference in height: Positive if measured point is higher than the construction line start point height.

Description

Road Alignment is an application used to measure or set out points relative to a defined element. The element can be a line, curve or spiral. Chainage, incremental set outs and offsets (left and right) are supported.

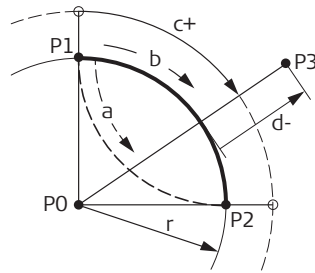


- P0 Center point
- P1 Start point of arc
- P2 End point of arc
- P3 Point to set out
- a Anti-clockwise
- b Clockwise
- c+ Distance from start of arc, following curve
- d- Perpendicular offset from arc
- r Radius of arc

Access

- 1) Select **Apps** from the **MAIN MENU**.
- 2) Select **Road** from the **APPS** menu.
- 3) Complete application pre-settings.
- 4) Select the element type:

- **Line**
- **Curve**
- **Spiral**


Elements

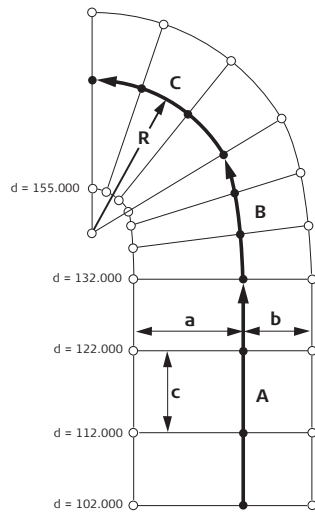

- A Straight
- B Spiral
- C Curve
- R Radius
- a Perpendicular offset left
- b Perpendicular offset right
- c Increment
- d Stationing


Define the element step-by-step

1. Enter, measure or select from memory the start and end points.
2. For curve and spiral elements the **ROAD** screen for defining the element appears.

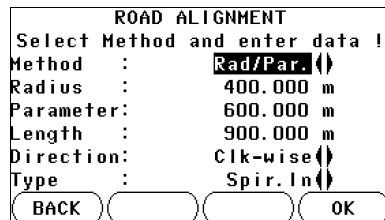

3. For a curve element:
 - Enter the radius and curve direction.
 - Press **OK**.

- For a spiral element:
 - Select the method to be used, **Rad/Par** or **Rad/Len**.
 - Enter the radius and parameter, or radius and length, depending on the method chosen.
 - Select the type and direction of the spiral.
 - Press **OK**.

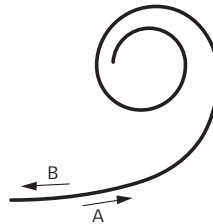

Spiral type

- A Spiral in
- B Sprial out

4. When the element has been defined the **ROAD-MAIN** appears.

Station and method

Enter the station values and press:

- **SET OUT**: to select the point and offset (center, left or right), to set out and start the measurement. The correction from actual point to set out point is shown on the display.
- **MEASURE**: to measure, or select points from memory, to calculate the chainage, line and offset from the defined element.

Enter set out values

Enter set out values!	
Station :	1100.000 m
Offs.Left :	5.000 m
Offs.Right:	4.000 m
Increment :	10.000 m
Z :	0.000 m
<input type="button" value="BACK"/> <input type="button" value="RESET"/> <input type="button" value="OK"/>	

Next step

- If in set out mode, press **OK** to begin setting out.
- Or, if in measurement mode, press **ALL** to measure and record.

11

Data Management

11.1


Data Management

Access

Select **Data** from the **MAIN MENU**.


DATA MANAGEMENT

The Data Management menu contains all functions for entering, editing, checking and deleting data in the field.

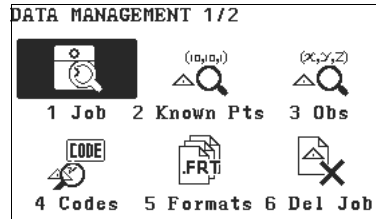

1 - 7

To select menu item.

Menu item	Description
Job	To view, create and delete jobs. Jobs are a summary of data of different types, for example, known points, observations or codes. The job definition consists of the job name and user. The system generates time and date at the time of creation.
Known points	To view, create, edit and delete known points. Valid fixed points contain at least the point ID and the coordinates E, N or H.
Observations	To view and delete observation data. Observation data available in the internal memory can be searched for via a specific point search, or by viewing all points within a job.
Code Library	To view, create, edit and delete codes. To each code a description and a maximum of 8 attributes with up to 16 characters each can be assigned.
Formats	To view and delete data format files.
Erase Job Memory	To delete individual jobs, known points and measurements of a specific job or all jobs in the memory.  Deleting the memory cannot be undone. After confirming the message all data is permanently deleted.
USB-Explorer	To view, delete, rename and create folders and files stored on the USB memory stick. Refer to "11.4 Working with a USB Memory Stick" and "Appendix B Directory Structure".

Next step

- Either, select a menu option using **1 - 7**.
- Or, press **ESC** to return to the **MAIN MENU**.

11.2

Exporting Data

Description

Job data can be exported from the internal memory of the instrument. Data can be exported via:

The RS232 serial interface

A receiver, such as a laptop, is connected to the RS232/USB port. The receiver requires GGO Data Exchange Manager or another third party software.



If the receiver is too slow in processing data the data could be lost. With this type of data transfer the instrument is not informed about the performance of the receiver (no protocol). Therefore the success of this type of transfer is not checked.

A USB memory stick

A USB memory stick can be inserted and removed from the USB host port. No additional software is required for the transfer.

Access

- 1) Select **Transfer** from the **MAIN MENU**.
- 2) Select **Export Data**.

DATA EXPORT

DATA EXPORT

To USB-Stick

Data Type Observations

Select Job J101

BACK SEARCH DISPL. OK

SEARCH

To search for jobs within the internal memory.

DISPL.

To list all jobs within the internal memory.

Field	Description
To	USB memory stick or RS232 serial interface.
Data Type	Data type to be transferred. Observations, Known Points or Obs. & Known points.
Select Job	Displays the selected job file.

Export data step-by-step

- 1) Press **OK** in the **DATA EXPORT** screen after selecting the export details.
- 2) Select the data format and press **OK** or **SEND**.



The **ASCII** data format is only available for data exports to a USB memory stick, not via the RS232 serial interface.



All jobs will be stored in the backup folder created on the USB memory stick. The job data will be stored as individual database files for each job, which can then be imported again. Refer to "11.3 Importing Data".

Exportable job data formats

Job data can be exported from a job in a variety of file types. A format can be defined in GGO Format Manager. Refer to the online help of GGO for information on creating format files.

RS232 example job data output

Within the **Data Type** setting **Observations**, a data set could be shown as follows:

11...+00000D19	21..022+16641826	22..022+09635023
31..00+00006649	58..16+00000344	81..00+00003342
82..00-00005736	83..00+00000091	87..10+00001700

GSI-IDs	GSI-IDs continued
11 △ Pt	41-49 △ Codes and attributes
21 △ Horizontal direction	51 △ ppm [mm]
22 △ Vertical angle	58 △ Prism constants
25 △ Orientation	81-83 △ (E, N, H) Target point
31 △ Slope distance	84-86 △ (E, N, H) Station point
32 △ Horizontal distance	87 △ Reflector height
33 △ Height difference	88 △ Instrument height

11.3

Importing Data

Description

Data can be imported to the internal memory of the instrument via a USB memory stick.

Importable data formats


When importing data, the instrument automatically stores the file in a directory folder based on the file extension. The following data formats can be imported:

Data Type	File extension	Recognised as
GSI	.gsi	Known points
Format	.fmt	Format file
Codelist	.cls	Codelist file

Access

- 1) Select **Transfer** from the **MAIN MENU**.
- 2) Select **Import Data**.

DATA IMPORT

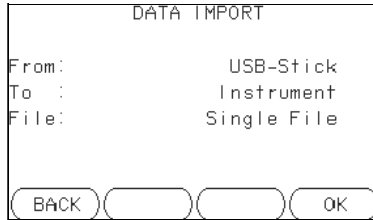

Field	Description
From	USB-Stick
To	Instrument
File	Single File


Import data step-by-step

- 1) Press **OK** in the **DATA IMPORT** screen to proceed to the USB memory stick file directory.
- 2) Select the file on the USB memory stick to be imported and press **OK**.
- 3) Define the Job name for the imported file, and, if requested, the file definition and layers, and press **OK** to import. If a Job with the same name already exists in the internal memory, a message will appear with the options to overwrite the existing job or rename the job for the file being imported.
- 4) A message will display once the file has been successfully imported.

11.4

Working with a USB Memory Stick

Insert a USB memory stick step-by-step

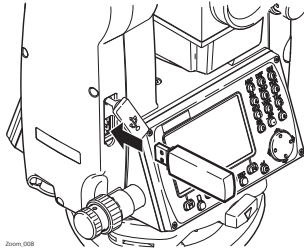

Lift the lid covering the USB host port on the instrument.

Insert the USB memory stick into the USB host port.



Always return to the **Main Menu** before removing the USB memory stick.



GeoMax cannot be held responsible for data loss or any other error that may occur when using a USB memory stick.



- Keep the USB memory stick dry.
 - Use it only within the specified temperature range.
 - Protect the USB memory stick from direct impacts.
- Failure to follow these instructions could result in data loss and/or permanent damage to the USB memory stick.

11.5

Working with Bluetooth

Description

Zoom30 Pro/Zoom35 Pro instruments can communicate with external devices via a Bluetooth connection. The instrument Bluetooth is a slave only. The Bluetooth of the external device will be the master, and therefore will control the connection and any data transfer.

Establishing a connection step-by-step

- 1) On the instrument ensure that the communication parameters are set to **Bluetooth** and **On**. Refer to "5.3 Communication Settings".
- 2) Activate Bluetooth on the external device. The steps required depend on the Bluetooth driver and other device specific configurations. Refer to the device user manual for information on how to configure and search for a Bluetooth connection.
The instrument will appear on the external device.
- 3) Some devices ask for the identification number of the Bluetooth. The default number for a Zoom Bluetooth is 0000. This can be changed by:
 - Select **Settings** from the **MAIN MENU**.
 - Select **Comm.** from the **SETTINGS** menu.
 - Press **BTCode** from the **COMMUNICATION SETTINGS** screen.

- Enter a new Bluetooth code in **BT-Code:**
 - Press **OK** to confirm the new Bluetooth code.
- 4 When the external Bluetooth device has located the instrument for the first time, a message will display on the instrument stating the name of the external device and requesting confirmation that connection to this device should be allowed.
 - Press **YES** to allow, or
 - Press **NO** to disallow this connection
 - 5 The instrument Bluetooth sends out the instrument name and serial number to the external Bluetooth device.
 - 6 All further steps must be made in accordance to the user manual of the external device.

Transferring data via Bluetooth

Using GGO Data Exchange Manager, data files can be transferred from the instrument to a local folder via the Bluetooth connection. The transfer is made through the serial port configured on the computer as the Bluetooth Serial Port, however, for faster data transfer speeds we recommend using the USB or RS232 connections.

For more information about GGO Data Exchange Manager refer to the comprehensive online help. For transferring data using other external devices or software programs, refer to the user manual of the device or software. The Zoom30 Pro/Zoom35 Pro Bluetooth does not establish or manage the data transfer.

11.6

Working with GeoMax Geo Office and GGO Tools

Description

The program package GGO is used for the data exchange between the instrument and a computer. It contains several auxiliary programs in order to support the instrument.

Installation on a computer

The installation program can be found on the CD-ROM supplied. Insert the CD and follow the on-screen instructions. Please note that GGO can only be installed on computers with MS Windows 2000, XP, Vista and Windows 7 operating systems.



For more information about GGO refer to the comprehensive online help.

12

Calibration

12.1

Overview

Description

GeoMax instruments are manufactured, assembled and adjusted to a high quality. Quick temperature changes, shock or stress can cause deviations and decrease the instrument accuracy. It is therefore recommended to calibrate the instrument from time to time. This can be done in the field by running through specific measurement procedures. The procedures are guided and have to be followed carefully and precisely as described in the following chapters. Some other instrument errors and mechanical parts can be adjusted mechanically.

Electronic calibration

The following instrument errors can be checked and calibrated electronically:

- Horizontal collimation error, also called line-of-sight error.
- Vertical index error, and simultaneously the electronic level.



For determining these errors, it is necessary to measure in both faces, but the procedure can be started in any face.

Mechanical calibration

The following instrument parts can be calibrated mechanically:

- Circular level on the instrument and tribrach.
- Laser plummet.
- Screws on the tripod.



During the manufacturing process, the instrument errors are carefully determined and set to zero. As mentioned, these errors can change and it is highly recommended to redetermine them in the following situations:

- Before the instrument is used for the first time.
- Before every high precision survey.
- After rough or long periods of transport.
- After long periods of work or storage.
- If the temperature difference between current environment and the temperature at the last calibration is more than 10°C (18°F).

12.2

Preparation



Before determining the instrument errors, level-up the instrument using the electronic level. The **Level & Plummet** is the first screen to appear after turning on the instrument. The tribrach, the tripod and the ground should be very stable and secure from vibrations or other disturbances.



The instrument should be protected from direct sunlight in order to avoid thermal expansion on one side only.




Before starting to work, the instrument has to become acclimatised to the ambient temperature. Approximately two minutes per °C of temperature difference from storage to working environment, but at least 15 min, should be taken into account.

12.3

Calibrating Line-of-Sight and Vertical Index Error

Line-of-sight error


The line-of-sight error, or horizontal collimation error is the deviation from the perpendicular between the tilting axis and the line of sight. The effect of the line-of-sight error to the horizontal direction increases with the vertical angle.

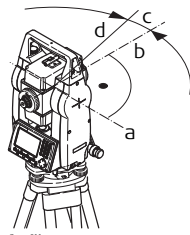

- a) Tilting axis
- b) Line perpendicular to tilting axis
- c) Horizontal collimation, or line-of-sight, error
- d) Line-of-sight

Vertical index error

The vertical circle should read exactly 90° (100 gon) when the line of sight is horizontal. Any deviation from this figure is termed vertical index error. This is a constant error that affects all vertical angle readings.

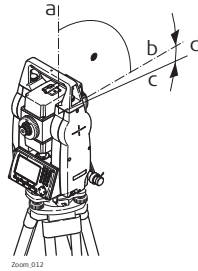

- a) Mechanical vertical axis of the instrument, also called standing axis
- b) Axis perpendicular to the vertical axis. True 90°
- c) Vertical angle is reading 90°
- d) Vertical index error

By determining the vertical index error the electronic level is adjusted automatically

Access

- 1) Select **Tools** from the **MAIN MENU**.
- 2) Select **Calibr.** from the **TOOLS MENU**.
- Select:
 - **HA-collimation**, or
 - **Vertical Index**.




The procedures and conditions required to correct line-of-sight and vertical index errors are the same, therefore the procedure will only be described once.

Calibration step-by-step

- 1) Level the instrument with the electronic level. Refer to "4 Operation"- "Level up with the electronic level step-by-step".


2

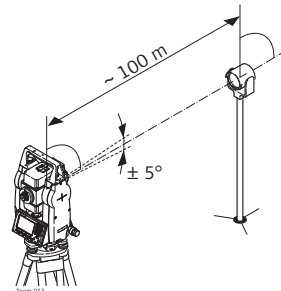

Aim at a point approximately 100 m from the instrument which is within 5° of the horizontal.

- 3 Press **REC** to measure to the target point.

4

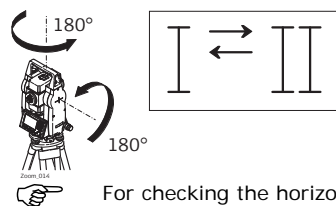

Change face and aim at the target point again

- For checking the horizontal aim, the difference in HA and VA are displayed.

- 5 Press **REC** to measure to the target point.



The old and new calculated values are displayed.

- 6 Either:

- Press **OK** to save the new calibration data, or
- Press **ESC** to exit without saving the new calibration data.

Messages

The following are important messages or warnings that may appear.


Messages	Description
VA-angle not suitable for adjustment !	The vertical angle deviates from the required horizontal / line-of-sight, or in face II the vertical angle deviates by more than 5° from the target point. Aim at the target point with an accuracy of min. 5°. Confirmation of the message required.
Results out of tolerance. Previous values retained !	Computed values out of tolerance. The previous values are retained and measurements should be repeated. Confirmation of the message required.
HA-angle not suitable for adjustment !	Horizontal angle in face II deviates by more than 5° from the target point. Aim on the target point with an accuracy of min. 5°. Confirmation of the message required.

Messages	Description
Measurement Error. Try again.	Measurement error appears when, for example, there is an unstable set up. Repeat the process. Confirmation of the message required.
Time limit exceeded ! Please repeat adjustment !	Time difference between measurements for results storage exceeds 15 minutes. Repeat the process. Confirmation of the message required.

12.4

Calibrating the Circular Level of the Instrument and Tribrach

Calibrate the circular level step-by-step

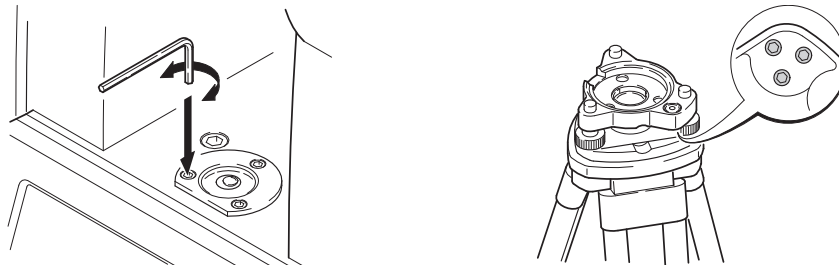

- 1 Place and secure the tribrach onto the tripod, and then secure the instrument onto the tribrach.
- 2 Using the tribrach footscrews, level the instrument with the electronic level. To activate the electronic level, turn on the instrument, and, if tilt correction is set to 1- or 2-axis, the **Level & Plummet** screen appears automatically. Alternatively, press **FNC** from within any application and select **Level & Plummet**.
- 3 The bubbles of the instrument and tribrach levels must be centered. If one or both circular levels are not centered, adjust as follows.

Instrument: If the bubble extends beyond the circle, use the Allen key supplied to center it with the adjustment screws.

Tribrach: If the bubble extends beyond the circle, adjust it using the adjustment pin in conjunction with the adjustment screws. Turn the adjustment screws:

- To the left: and the bubble approaches the screw.
- To the right: and the bubble goes away from the screw.

- 4 Repeat step 3 on the instrument and tribrach until both circular levels are centered and no further adjustments are necessary.



After the calibration, no adjustment screw should be loose.


12.5

Inspecting the Laser Plummet of the Instrument



The laser plummet is integrated into the vertical axis of the instrument. Under normal conditions of use, the laser plummet does not need adjusting. If an adjustment is necessary due to external influences, the instrument has to be returned to a GeoMax service department.

Inspect the laser plummet step-by-step

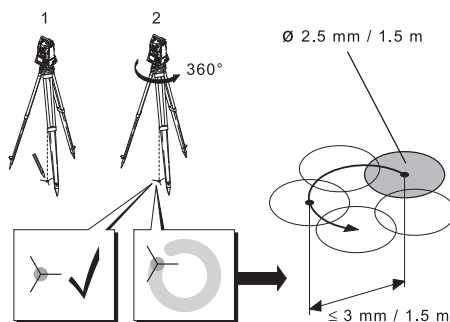


- 1) Set up the instrument on the tripod approximately 1.5 m above the ground and level up.
- 2) To activate the laser plummet, turn on the instrument, and, if tilt correction is set to 1- or 2-axis, the laser plummet will be activated automatically, and the **Level & Plummet** screen appears. Otherwise, press **FNC** from within any application and select **Level & Plummet**.



Inspection of the laser plummet should be carried out on a bright, smooth and horizontal surface, such as a sheet of paper.


- 3 Mark the center of the red laser dot on the ground.

- 4 Turn the instrument slowly through 360°, carefully observing the movement of the red laser dot.
 The maximum diameter of the circular movement described by the center of the laser dot should not exceed 3 mm at a height of 1.5 m.
- 5 If the center of the laser dot makes a clearly circular movement, or moves more than 3 mm away from the point which was first marked, an adjustment may be required. Call your nearest GeoMax service department.
Depending on brightness and surface type, the size of the laser dot can vary. At a height of 1.5 m an average diameter of 2.5 mm is estimated.

12.6

Servicing the Tripod

Service the tripod step-by-step

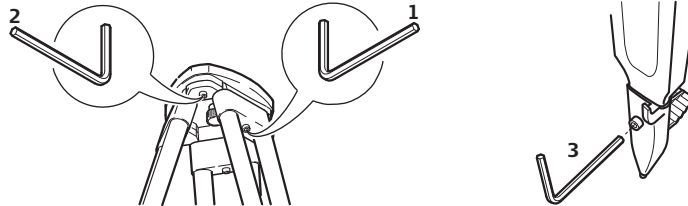

 The connections between metal and timber components must always be firm and tight.

- 1) Tighten the leg cap screws moderately with the allen key supplied.
 - 2) Tighten the articulated joints on the tripod head just enough to keep the tripod legs open when lifting the tripod off the ground.
 - 3) Tighten the screws of the tripod legs.
-

13

Care and Transport

13.1

Transport

Transport in the field	When transporting the equipment in the field, always make sure that you <ul style="list-style-type: none">• either carry the product in its original transport container,• or carry the tripod with its legs splayed across your shoulder, keeping the attached product upright.
Transport in a road vehicle	Never carry the product loose in a road vehicle, as it can be affected by shock and vibration. Always carry the product in its transport container and secure it.
Shipping	When transporting the product by rail, air or sea, always use the complete original GeoMax packaging, transport container and cardboard box, or its equivalent, to protect against shock and vibration.
Shipping, transport of batteries	When transporting or shipping batteries, the person in charge of the product must ensure that the applicable national and international rules and regulations are observed. Before transportation or shipping, contact your local passenger or freight transport company.
Field adjustment	Periodically carry out test measurements and perform the field adjustments indicated in the User Manual, particularly after the product has been dropped, stored for long periods or transported.


13.2

Storage

Product	Respect the temperature limits when storing the equipment, particularly in summer if the equipment is inside a vehicle. Refer to "14 Technical Data" for information about temperature limits.
Field adjustment	After long periods of storage inspect the field adjustment parameters given in this user manual before using the product.
Li-Ion batteries	<ul style="list-style-type: none">• Refer to "14 Technical Data" for information about storage temperature range.• Remove batteries from the product and the charger before storing.• After storage recharge batteries before using.• Protect batteries from damp and wetness. Wet or damp batteries must be dried before storing or use.• A storage temperature range of 0°C to +30°C / +32°F to +86°F in a dry environment is recommended to minimize self-discharging of the battery.• At the recommended storage temperature range, batteries containing a 40% to 50% charge can be stored for up to one year. After this storage period the batteries must be recharged.

13.3

Cleaning and Drying

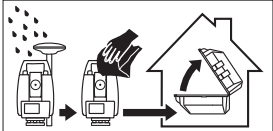Objective, eyepiece and reflectors	<ul style="list-style-type: none">• Blow dust off lenses and prisms.• Never touch the glass with your fingers.• Use only a clean, soft, lint-free cloth for cleaning. If necessary, moisten the cloth with water or pure alcohol. Do not use other liquids; these may attack the polymer components.
Fogging of prisms	Prisms that are cooler than the ambient temperature tend to fog. It is not enough simply to wipe them. Keep them for some time inside your jacket or in the vehicle to allow them to adjust to the ambient temperature.
Damp products	Dry the product, the transport container, the foam inserts and the accessories at a temperature not greater than 40°C /104°F and clean them. Remove the battery cover and dry the battery compartment. Do not repack until everything is completely dry. Always close the transport container when using in the field. 
Cables and plugs	Keep plugs clean and dry. Blow away any dirt lodged in the plugs of the connecting cables.
Connectors with dust caps	Wet connectors must be dry before attaching the dust cap.

14

Technical Data

14.1

Angle Measurement

Accuracy

Available angular accuracies	Standard deviation HA, VA, ISO 17123-3	Display resolution			
		["]	[°]	[mgon]	[mil]
2	0.6	1	0.0001	0.1	0.01
3	1.0	1	0.0001	0.1	0.01
5	1.5	1	0.0001	0.1	0.01
7	2	1	0.0001	0.1	0.01

Characteristics

Absolute, continuous, diametric. Updates each 0.1 to 0.3 s.

14.2

Distance Measurement with Reflectors

Range

Reflector	Range A		Range B		Range C	
	[m]	[ft]	[m]	[ft]	[m]	[ft]
Standard prism	1800	6000	3000	10000	3500	12000
3 prisms						
A2/A4/A6	2300	7500	3000	10000	3500	12000
A10	2300	7500	4500	14700	5400	17700
Reflector foil 60 mm x 60 mm	150	500	250	800	250	800

Shortest measuring distance: 1.5 m

Atmospheric conditions

Range A: Strong haze, visibility 5 km; or strong sunlight, severe heat shimmer
 Range B: Light haze, visibility about 20 km; or moderate sunlight, slight heat shimmer
 Range C: Overcast, no haze, visibility about 40 km; no heat shimmer

Accuracy

Accuracy refers to measurements to standard reflectors.

EDM measuring mode	Standard deviation ISO 17123-4 A2/A4/A6/A10	Measurement time, typical [s]	
		A2/A4/A6	A10
IR-Default	2 mm + 2 ppm	2.4	2.4
IR-Quick	5 mm + 2 ppm	2.0	1.0
IR-Continuous	5 mm + 2 ppm	0.33	0.3
Foil	5 mm + 2 ppm	2.4	2.4

Beam interruptions, severe heat shimmer and moving objects within the beam path can result in deviations of the specified accuracy.

Characteristics

Principle: Phase measurement
 Type: Coaxial, visible red laser
 Carrier wave: 658 nm
 Measuring system:
 A2/A4/A6: Distance measurement system using phase-shift principle with frequency 320 MHz
 A10: System analyser basis 100 MHz - 150 MHz

Range

A2 (without reflector)

Kodak Gray Card	Range D		Range E		Range F	
	[m]	[ft]	[m]	[ft]	[m]	[ft]
White side, 90 % reflective	150	490	180	590	≤250	≤820
Grey side, 18 % reflective	80	260	100	330	≤110	≤360

A4 (without reflector)

Kodak Gray Card	Range D		Range E		Range F	
	[m]	[ft]	[m]	[ft]	[m]	[ft]
White side, 90 % reflective	200	660	300	990	≤400	≤1310
Grey side, 18 % reflective	100	330	150	490	≤200	≤660

A6 (without reflector)

Kodak Gray Card	Range D		Range E		Range F	
	[m]	[ft]	[m]	[ft]	[m]	[ft]
White side, 90 % reflective	350	1150	450	1480	≤600	≤1970
Grey side, 18 % reflective	200	660	250	820	≤350	≤1150

A10 (without reflector)

Kodak Gray Card	Range D		Range E		Range F	
	[m]	[ft]	[m]	[ft]	[m]	[ft]
White side, 90 % reflective	600	1970	800	2630	≤1000	≤3280
Grey side, 18 % reflective	300	990	400	1310	≤500	≤1640

Atmospheric conditions

Range D: Object in strong sunlight, severe heat shimmer
 Range E: Object in shade, or overcast
 Range F: Underground, night and twilight

Accuracy

Standard measuring	ISO 17123-4	Measure time, typical [s]	Measure time, maximum [s]
0 m - 500 m	3 mm + 2 ppm	3 - 6	15
>500 m	5 mm + 2 ppm	3 - 6	15

Beam interruptions, severe heat shimmer and moving objects within the beam path can result in deviations of the specified accuracy.

Continuous measuring*	Standard deviation	Measure time, typical [s]	
		A2/A4/A6	A10
Continuous	5 mm + 3 ppm	1.00	0.25

* Accuracy and measure time depend on atmospheric conditions, target object and observation situation.

Characteristics

Type: Coaxial, visible red laser
 Carrier wave: 658 nm
 Measuring system:
 A2/A4/A6: Distance measurement system using phase-shift principle with frequency 320 MHz
 A10: System analyser basis 100 MHz - 150 MHz

Laser dot size

Distance [m]	Laser dot size, approximately [mm]
at 30	7 x 10
at 50	8 x 20

14.4

Distance Measurement Reflector (Long Range)



This chapter is valid for A10 only.

Range

Reflector	Range A		Range B		Range C	
	[m]	[ft]	[m]	[ft]	[m]	[ft]
Standard prism	2200	7300	7500	24600	>10000	>33000
Reflector foil 60 mm x 60 mm	600	2000	1000	3300	1300	4200

Range of measurement:

From 1000 m up to 12000 m

Display unambiguous:

Up to 12 km

Atmospheric conditions

Range A: Strong haze, visibility 5 km; or strong sunlight, severe heat shimmer
Range B: Light haze, visibility about 20 km; or moderate sunlight, slight heat shimmer
Range C: Overcast, no haze, visibility about 40 km; no heat shimmer

Accuracy

Standard measuring	ISO 17123-4	Measure time, typical [s]	Measure time, maximum [s]
Long range	5 mm + 2 ppm	2.5	12

Beam interruptions, severe heat shimmer and moving objects within the beam path can result in deviations of the specified accuracy.

Characteristics

Principle: Phase measurement
Type: Coaxial, visible red laser
Carrier wave: 658 nm
Measuring system: System analyser basis 100 MHz - 150 MHz

14.5

Conformity to National Regulations

14.5.1

Zoom20 Pro

Conformity to national regulations



Hereby, GeoMax AG, declares that the instrument is in compliance with the essential requirements and other relevant provisions of applicable European Directives. The declaration of conformity is available from GeoMax AG.

14.5.2

Zoom30 Pro/Zoom35 Pro

Conformity to national regulations

- FCC Part 15 (applicable in US).
- Hereby, GeoMax AG, declares that the Zoom30 Pro/Zoom35 Pro instrument is in compliance with the essential requirements and other relevant provisions of Directive 1999/5/EC and other applicable European Directives. The declaration of conformity is available from GeoMax AG.



Class 1 equipment according European Directive 1999/5/EC (R&TTE) can be placed on the market and be put into service without restrictions in any EEA Member state.

- The conformity for countries with other national regulations not covered by the FCC part 15 or European directive 1999/5/EC has to be approved prior to use and operation.

Frequency band

2402 - 2480 MHz

Output power

Bluetooth: 2.5 mW

14.6

General Technical Data of the Instrument

Telescope

Magnification: 30 x
Free Objective aperture: 40 mm
Focusing: 1.7 m/5.6 ft to infinity
Field of view: 1° 30'/1.66 gon.
2.7 m at 100 m

Compensation

Quadruple axis compensation (2-axis compensator with HA-collimation and VA-Index).

Angular accuracy	Setting accuracy		Setting range	
["']	["']	[mgon]	["']	[gon]
2	0.5	0.2	±4	0.07
3	1	0.3	±4	0.07
5	1.5	0.5	±4	0.07
7	2	0.7	±4	0.07

Level

Circular level sensitivity: 6'/2 mm
Electronic level resolution: 2"

Control unit


B&W display: 288 x 160 pixels, LCD, backlit, 8 lines with 31 characters each, heatable (temp. < -5°).
C&T display: 320 x 240 pixels (QVGA), LCD, backlit, 9 lines with 31 characters each, keyboard illumination

Instrument Ports

Name	Description
Serial/USB	6 pin Hiroshi for power, communication, data transfer. This port is located at the base of the instrument.
USB host port	USB memory stick port for data transfer.
Bluetooth*	Bluetooth connections for communication and data transfer.

* Only for Zoom30 Pro/Zoom35 Pro instruments.

Instrument Dimensions

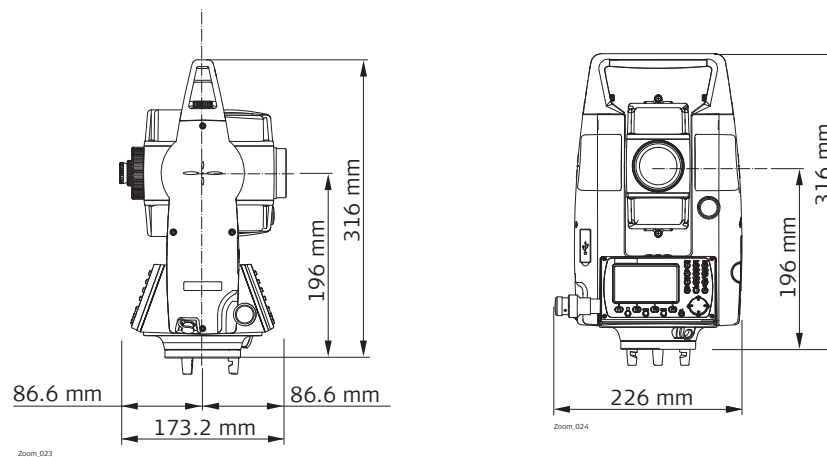

Weight

Instrument: 4.2 kg - 4.5 kg (depending on hardware configuration)
Tribrach: 760 g
Battery ZBA400: 110 g

Tilting axis height

Without tribrach: 196 mm
With tribrach: 240 mm ±5 mm

Recording

Model	Memory Type	Number of measurements
Zoom20 Pro Zoom30 Pro Zoom35 Pro	Internal memory	10,000

Laser plummet

Type: Visible red laser class 2
Location: In standing axis of instrument
Accuracy: Deviation from plumb line:
1.5 mm (2 sigma) at 1.5 m instrument height
Diameter of laser point: 2.5 mm at 1.5 m instrument height

PowerExternal supply voltage:
(via serial interface)

Nominal voltage 12.8 V DC, Range 11.5 V-14 V

Battery ZBA400

Type: Li-Ion
 Voltage: 7.4 V
 Capacity: 4.4 Ah
 Operating time*: approximately 9 hours

* Based on a single measurement every 30 s at 25°C. Operating time may be shorter if battery is not new.

Environmental specifications**Temperature**

Type	Operating temperature		Storage temperature	
	[°C]	[°F]	[°C]	[°F]
Zoom instrument	-20 to +50	-4 to +122	-40 to +70	-40 to +158
Battery	-20 to +50	-4 to +122	-40 to +70	-40 to +158

Protection against water, dust and sand

Type	Protection
Zoom instrument	IP54 (IEC 60529)

Humidity

Type	Protection
Zoom instrument	Max 95% non condensing. The effects of condensation are to be effectively counteracted by periodically drying out the instrument.

Navigation Light

Available for Zoom30 Pro.

Working range: 5 m to 150 m (15 ft to 500 ft)
 Position accuracy: 5 cm at 100 m (1.97" at 330 ft)

Automatic corrections

The following automatic corrections are made:

- Line of sight error
- Tilting axis error
- Earth curvature
- Standing axis tilt
- Vertical index error
- Refraction
- Compensator index error
- Circle eccentricity

14.7**Scale Correction****Use of scale correction**

By entering a scale correction, reductions proportional to distance can be taken into account.

- Atmospheric correction.
- Reduction to mean sea level.
- Projection distortion.

Atmospheric correction

The slope distance displayed is correct if the scale correction in ppm, mm/km, which has been entered corresponds to the atmospheric conditions prevailing at the time of the measurement.

The atmospheric correction includes:


- Adjustments for air pressure
- Air temperature

For highest precision distance measurements, the atmospheric correction should be determined with:

- An accuracy of 1 ppm
- Air temperature to 1°C
- Air pressure to 3 mbar


Atmospheric corrections °C

Atmospheric corrections in ppm with temperature [°C], air pressure [mb] and height [m] at 60 % relative humidity.

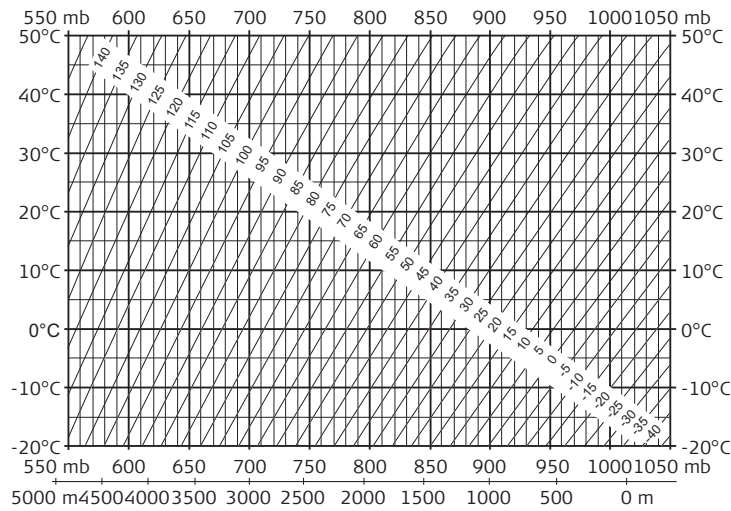

Atmospheric correction °F


Atmospheric corrections in ppm with temperature [°F], air pressure [inch Hg] and height [ft] at 60 % relative humidity.

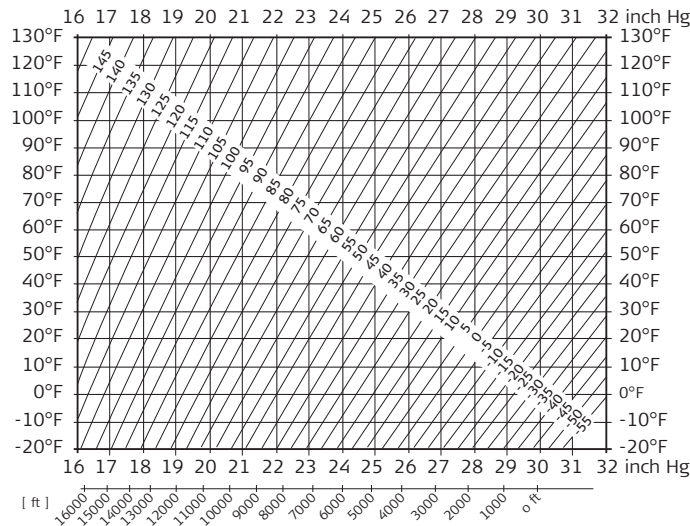

14.8

Reduction Formulas

Formulas

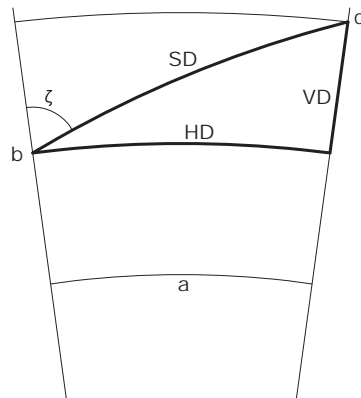

- a Mean Sea Level
- b Instrument
- c Reflector
- SD Slope distance
- HD Horizontal distance
- VD Height difference

The instrument calculates the slope distance, horizontal distance, and height difference in accordance with the following formulas. Earth curvature ($1/R$) and mean refraction coefficient ($k = 0.13$) are automatically taken into account when calculating the horizontal distance and height difference. The calculated horizontal distance relates to the station height and not to the reflector height.

Slope distance

$$SD = D_0 \cdot (1 + \text{ppm} \cdot 10^{-6}) + \text{mm}$$

SD Displayed slope distance [m]
D0 Uncorrected distance [m]
ppm Atmospheric scale correction [mm/km]
mm prism constant [mm]

Horizontal distance

$$HD = Y - A \cdot X \cdot Y$$

HD Horizontal distance [m]
Y $SD \cdot \sin\zeta$
X $SD \cdot \cos\zeta$
 ζ = Vertical circle reading
A $(1 - k/2)/R = 1.47 \cdot 10^{-7} [\text{m}^{-1}]$
k = 0.13 (mean refraction coefficient)
R = $6.378 \cdot 10^6$ m (radius of the earth)

Height difference

$$VD = X + B \cdot Y^2$$

VD Height difference [m]
Y $SD \cdot \sin\zeta$
X $SD \cdot \cos\zeta$
 ζ = Vertical circle reading
B $(1 - k)/2R = 6.83 \cdot 10^{-8} [\text{m}^{-1}]$
k = 0.13 (mean refraction coefficient)
R = $6.378 \cdot 10^6$ m (radius of the earth)


Software Licence Agreement

This product contains software that is preinstalled on the product, or that is supplied to you on a data carrier medium, or that can be downloaded by you online according to prior authorisation from GeoMax. Such software is protected by copyright and other laws and its use is defined and regulated by the GeoMax Software Licence Agreement, which covers aspects such as, but not limited to, Scope of the Licence, Warranty, Intellectual Property Rights, Limitation of Liability, Exclusion of other Assurances, Governing Law and Place of Jurisdiction. Please make sure, that at any time you fully comply with the terms and conditions of the GeoMax Software Licence Agreement.

Such agreement is provided together with all products and can also be referred to and downloaded at the GeoMax home page at <http://www.geomax-positioning.com> or collected from your GeoMax distributor.

You must not install or use the software unless you have read and accepted the terms and conditions of the GeoMax Software Licence Agreement. Installation or use of the software or any part thereof, is deemed to be an acceptance of all the terms and conditions of such Licence Agreement. If you do not agree to all or some of the terms of such Licence Agreement, you must not download, install or use the software and you must return the unused software together with its accompanying documentation and the purchase receipt to the distributor from whom you purchased the product within ten (10) days of purchase to obtain a full refund of the purchase price.

Instrument axis

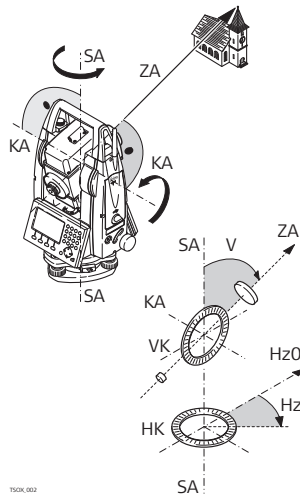

ZA = Line of sight / collimation axis

Telescope axis = line from the cross hairs to the center of the objective.

SA = Standing axis

Vertical rotation axis of the telescope.

KA = Tilting axis

Horizontal rotation axis of the telescope. Also known as the Trunion axis.

V = Vertical angle / zenith angle

VK = Vertical circle

With coded circular division for reading the vertical angle.

Hz = Horizontal direction

HK = Horizontal circle

With coded circular division for reading the horizontal angle.

Plumb line / compensator




Direction of gravity. The compensator defines the plumb line within the instrument.

Standing axis inclination




Angle between plumb line and standing axis. Standing axis tilt is not an instrument error and is not eliminated by measuring in both faces. Any possible influence it may have on the horizontal direction or vertical angle is eliminated by the dual axis compensator.

Zenith




Point on the plumb line above the observer.

Crosshairs




Glass plate within the telescope with reticle.

Line-of-sight error (horizontal collimation)

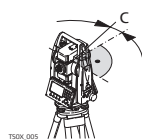


The line-of-sight error (c) is the deviation from the perpendicular between the tilting axis and line of sight. This could be eliminated by measuring in both faces.

Vertical index error

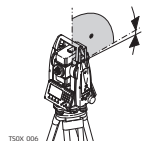

With a horizontal line of sight the vertical circle reading should be exactly 90° (100 gon). The deviation from this value is termed the Vertical index error (i).

Explanation of displayed data

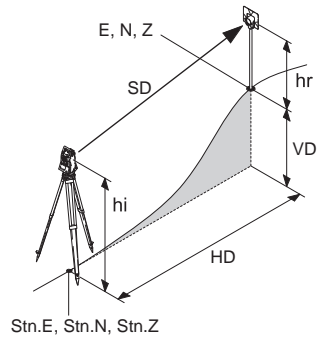


- SD Indicated meteorological corrected slope distance between instrument tilting axis and center of prism/laser dot
- HD Indicated meteorological corrected horizontal distance
- VD Height difference between station and target point
- hr Reflector height above ground
- hi Instrument height above ground
- Stn.E, Stn.N, Stn.Z Easting, Northing and Height coordinates of station
- E, N, Z Easting, Northing and Height coordinates of target point



Depending on local firmware versions the menu items may differ.

Menu Tree

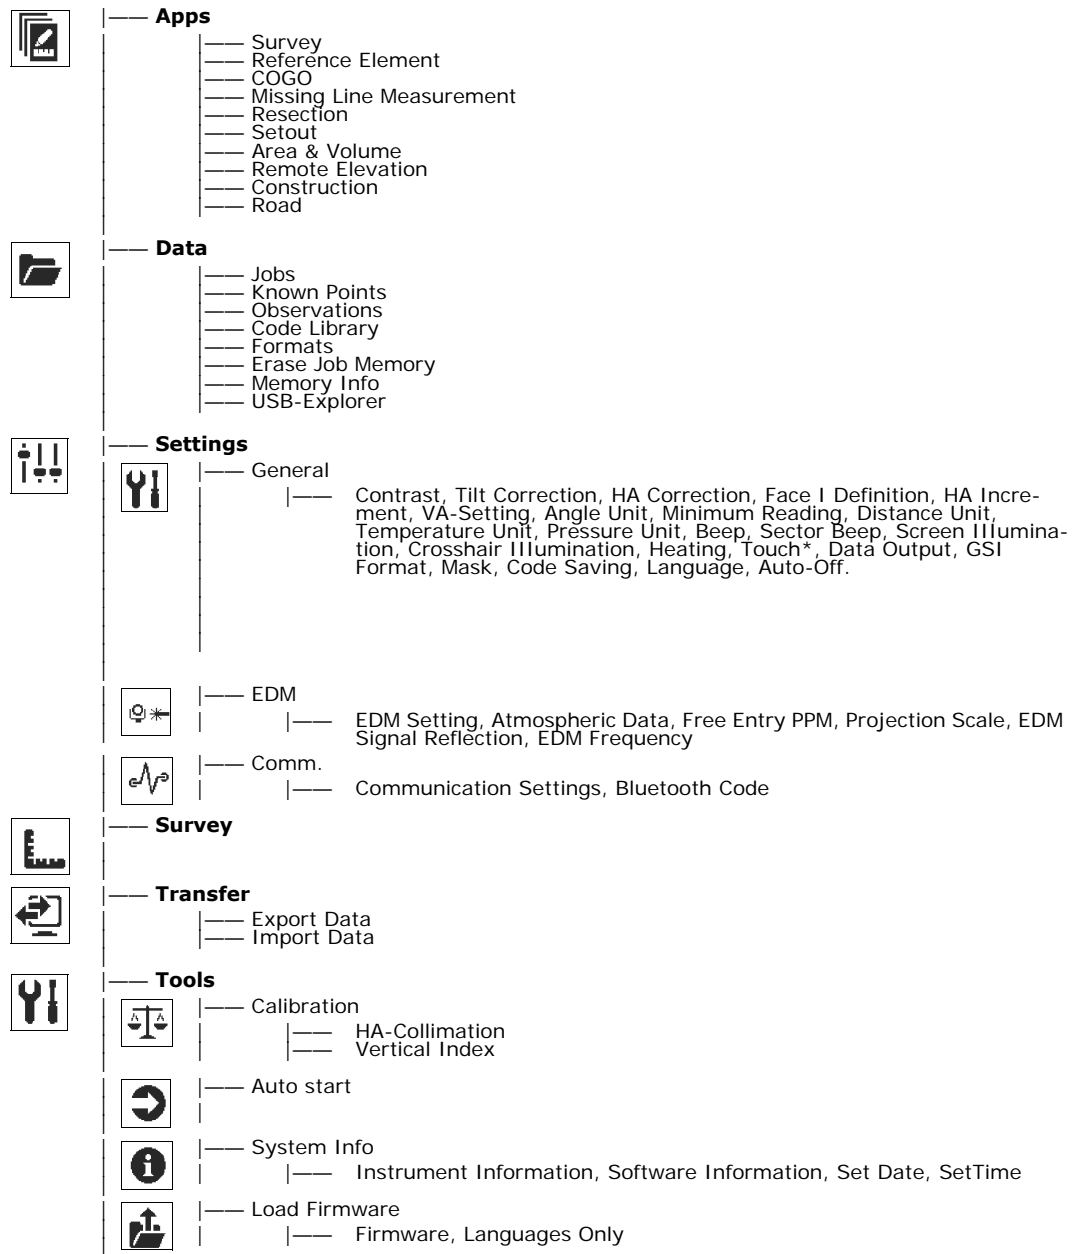

* Valid for Color&Touch displays only

Appendix B Directory Structure

Description

On the USB memory stick, files are stored in certain directories. The following diagram is the default directory structure.

Directory Structure

—	CODES	<ul style="list-style-type: none">• Codelists (*.cls)
—	FORMATS	<ul style="list-style-type: none">• Format files (*.fmt)
—	JOBS	<ul style="list-style-type: none">• GSI, DXF, ASCII files (*.*)• Logfiles created from applications
—	SYSTEM	<ul style="list-style-type: none">• Firmware files• Language files• Configuration files (*.cfg)

Index

2		
2 Dist. Offset	34	
A		
Accuracy		
Angle measurement	70	
IR mode	70	
Reflectorless mode	71	
RL mode	72	
Angle measurement	70	
Angle unit, setting of	27	
Application		
Survey	42	
Applications		
Area & Volume	55	
COGO	48	
Construction	57	
Reference Element	42, 46	
Remote Elevation	57	
Resection	52	
Road	59	
Set Out	54	
Applications - Getting Started	38	
Pre-settings for applications	38	
Select Job	38	
Select Orientation	39	
Select Station	39	
Set accuracy limit	52	
Set EDM	57	
Area & Volume, application	55	
Atmospheric data, setting of	29	
Auto start routine	31	
Auto-Off, setting of	28	
B		
Base line	43	
Batteries		
Operation, Discharging	23	
Battery		
Changing of	23	
Icon	18	
Labelling	14	
Technical data ZBA400	74	
Baudrate	30	
Beep, setting of	27	
Bluetooth		
Code	29	
Communication setup	30	
Connection	63	
Data transfer	64	
Icon	18	
Output power	72	
Safety directions	13	
C		
Calibration	65	
Combined calibration	65	
Electronic	65, 66	
Errors, view current	31	
Inspecting laser plummet	67	
Line of sight	65	
Mechanical	65	
Of circular level on instrument	67	
Of circular level on tribrach	67	
Preparation	65	
Touch screen	28	
Vertical index	65	
Care	69	
Circular level, calibration of	67	
Cleaning and Drying	69	
Code		
Bluetooth Code	29, 63	
Code Library	37	
Coding		
Code library	33	
Data management	61	
Editing / Extending	37	
GSI coding	37	
COGO, application	48	
Collimation axis	78	
Communication Settings	29	
Compensation	73	
Compensator, icon	18	
Connecting Bluetooth	63	
Constants, prism	29	
Construction, application	57	
Container contents	15	
Continuous, EDM	36	
Contrast, setting of	26	
Control Distance	35	
Coordinates, orientation with	40	
Corrections		
Atmospheric	74	
Automatic	74	
Scale	74	
Crosshair illumination, setting of	27	
Crosshairs	78	
D		
Data		
Storage	23	
Transfer	61	
Data formats	62	
Data management	61, 61	
Data output, setting location of	28	
Data types	62	
Databits	30	
Date	31	
Definition of Use	6	
Delete last observation	33	
Dimensions, of instrument	73	
Directory structure	81	
Display heater, setting of	27	
Display, technical details of	73	
Distance Offset	33	
Distance unit, setting of	27	
E		
Edit fields, how to	19	
Electromagnetic compatibility EMC	12	
Electronic calibration	65	
Electronic Distance Measurement EDM	24	
Continuous	36	
Icons	18	
Laserbeam	29	
Prism (Long Range)	72	
Prism constant	29	
Prism mode	70	
Prism Types	29	
RL Mode	9, 71	
Settings	28	
Signal reflection	29	

Electronic level, level up instrument	22	Laser plummet	
Endmark	30	Adjust intensity	22
Erase job memory	61	Inspect	67
Export data	61	Safety directions	11
Extension, COGO application	51	Technical data	73
F		Laserbeam	
Face, setting of	26	On/Off	33
FCC Statement	13	Setting of	29
Fields, common	42	Level	73
File extensions	62	Level / Plummet screen, access	33
Firmware information	32	Li-Ion battery	
Folder structure	81	Storage	69
Formats, management of	61	Limits of use	7
Formatting		Line of sight	78
Internal memory	32	Calibration	65
Free PPM, setting of	29	M	
Functions FNC		Main menu	23
Access	33	Manual angle setting, orientation	40
Description of	33	Manual, validity of	2
FNC key	17	Mechanical calibration	65
G		Menu tree	80
GGO/GGO Tools		Minimum reading, setting of	27
Description	15	N	
Glossary	78	Navigation key	17
GSI		Navigation Light	
Coding	37	Safety directions	11
Output mask, setting of	28	Navigation Light NavLight	
Output format, setting of	28	Technical data	74
H		O	
HA corrections, setting of	26	Observation data	61
HA increment	26	Offsets, COGO application	50
Horizontal angle, setting of	26	Operating concept	15
I		Operating temperature	74
Icons	18	Operation, of instrument	21
Import data	62	Orientation	
Instrument		Manual angle setting	40
Components	16	With Coordinates	40
Dimensions	73	P	
Level up	22	Parity	30
Ports	73	Plumb line	78
Settings	26	Point search	19
Setup	21	Pole Length	34
Technical Data	72	Ports	
Instrument components	16	Communication setup	30
Instrument information	31	Instrument ports	73
Intersections, COGO application	49	PPM, setting of	29
Inverse and traverse, COGO application	49	Pressure unit, setting of	27
J		Prism	
Job, management of	61	GeoMax constant	29
K		Type	29
Keyboard	17	Prism measurements	24
Keys	17	Projection scale, setting of	29
Known point data	61	Q	
L		Quadruple-axis compensation	73
Labelling	9, 10, 12, 13, 14	R	
Language		Recording code, setting of	28
Deleting	26	Reduction Formulas	75
Upload language	32	Reference Arc, application	46
Language, setting of	28	Reference Line, application	42
Laser		Refraction coefficient	76, 76
Classification	8	Remote Elevation, application	57
Distancer	24	Remote point	57
		Resection, application	52
		Responsibilities	7

RL measurements	24
Road, application	59
RS232	
Icons	18
RS232, communication setup	30

S

Safety Directions	6
Screen	17
Screen illumination, setting of	27
Search	19
Sector beep, setting of	27
Select job	38
Select orientation	39
Select station	39
Set Out, application	54
Settings, configuration of	26
Settings, setting of	26
Setup	
Instrument	21
Tripod	21
Softkeys	18
Software	
Loading	32
Software information	
Application information	32
Software Licence Agreement	77
Standing axis	78
Stopbits	30
Storage	69
Storage temperature	74
Survey application	24, 42

T

Technical data	70
Telescope	72
Temperature	
Battery	74
Instrument	74
Temperature unit, setting of	27
Terminology	78
Tilt and horizontal corrections	28
Tilt correction, setting of	26
Tools	
Auto start	31
Calibration	31
Load Software	32
System Information	31
Touch screen, activate/deactivate	27
Transport	69
Tripod	
Service	68
Setup	21

U

Units, settings of	27
Upload languages	32
Upload software	32
USB	
Directory Structure	81
Explorer	61
Icon	18
Inserting	63
User Interface	17

V

Vertical angle	
Description	78
Setting of	26

Vertical index	
Calibration	65
Description	78

W

Weight	73
Wildcard search	20

Z

Z-Coordinate	33, 34
Zenith	26, 78
Zenith angle	78
Zoom 30 frequency band	72

GeoMax Zoom20/30/35 Pro Series



780085-2.0.0en

Original text

© 2013 GeoMax AG, Widnau, Switzerland

GeoMax AG

www.geomax-positioning.com